

Service Information

Offboard Diagnostic Information System Service (ODIS Service)

Number: VOS-20-05

Subject: Software Version Update, Enhancements and Fixes

Date: Jan. 22, 2019

Supersedes VOS-19-34 due to new diagnostic content version.

The following ODIS Service software versions are available for download.

Current ODIS Service Software Versions	
Application: V5.1.6	Diagnostic Content: V2.39.14

Key Fixes/Enhancements for Diagnostic Content: V2.39.14:

1. CA/CM Atlas 2018 – 2020

U104900: Optical data bus open circuit

MOS_X_X_J794_1_0113_11_MOST_Unterbrechung_00011 does not list the J525 - sound system module as a component of the MOST bus.

- Test incorrectly replaces the Instrument Cluster J285 but the error was actually from the J525.

2. A3 - Passat/New Midsize Sedan 2011 – 2015, CKRA 2.0 L TDI-CR / 103 kW

P20E800: Reductant pressure too low SYS_XX_J623_XXXX_1_0510_11_SCR_Systemtest_00011 SCR systems leak-tightness test detects a malfunction with average reducing agent pressure at 4.61 bar but the specified is at 4.4 ... 5.2bar.

3. 7P - Touareg 2010 – 2017, CGRA 3.6 L FSI / 206kW

P025A00: Fuel Pump Module Control Circuit/Open J538_7P_CGEA_1_0310_11_00011 test for supply pressure of fuel pump (FP) does not complete. Test not successful! Exited due to reasons of safety.

Service Information

- Test instruction is ignition ON but fails for reason Engine not ON. Engine running / ignition ON / ignition OFF status during testing is not clear.

4. BU - Jetta 2018 – 2020, DDSA 2.0l Simos/130 kW

Readiness test SYS_J623_1_0816_11_X_X_MSG_OT_SOD_ReadinessCodeErzeugen_00000

continuously fails with error message: Basic setting: Automatic test procedure - Status: could not be exited. Test is optimized.

5. 7P - Touareg 2010 – 2017, CATA 3.0 L TDI-CR 165kW

DTC P03A7: Cylinder 2 Pressure variation high active/static is not linked to a function test and no test created in current test plans.

6. CA/CM Atlas 2018 – 2020

B7 - Interface for Access/Start fault B147101: sensor 1 for rear lid opening electrical error

J938_X_1_0914_11_VIP_pruefen_00000 replaces components and does not check wiring.

7. A3 - Passat/New Midsize Sedan 2011 - 2017, CPRA 1.8l Simos / 125 kW

Inlet camshaft adjustment test J623_X_1_0918_11_X_ENW_Verstellung_pruefen_00011

malfunction.

- Inlet camshaft phasing bank 1 test result data could not be read. Test instruction: send a feedback.

8. A3 - Passat/New Midsize Sedan 2011 – 2017, CVCA 2.0l TDI SCR / 110 kW

DTC P026A00: Charge air cooler efficiency below threshold is not linked to a function test and no test plan created in current test plans.



Service Information

9. BW - Tiguan 2018 – 2019

B125C13: Video line open circuit SIG_X_J928_1_0914_11_Videoverbindung_00000 test for the - J28- peripheral camera control module, does not specify which camera -front/rear/left/right- video cable and plug-in connections to check for the fault code.

10.7P - Touareg 2010 – 2017, CGRA 3.6 L FSI / 206kW

C110702 - Video line for image processing signal malfunction

SYS_7P_J851_1_1111_11_Videoleitung_Signalfehler_00011 test ends with the fault still stored in the event memory of the control module for image processing -J851.

11.A3 - Passat/New Midsize Sedan 2011 – 2017

B10001B: Driver airbag igniter Resistance too high test N95_X_1_0312_11_00011 ends abruptly without performing any system diagnosis.

12. General translation errors