



Preliminary Information

PIT5730 Service Brake System, Reduced Engine Power, Speed Limited messages on the DIC and SES MIL on with DTC's C0021 and P0606 setting

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Silverado 1500	2020	All	All	All	All
GMC	Sierra 1500	2020	All	All	All	All

Involved Region or Country	North America
Condition	Some customers may comment that the Service Brake System, Reduced Engine Power, and Speed Limited messages on the DIC. Along with these messages, a SES MIL will be on and the brake pedal may feel hard. When checking for DTC's the Brake System Control Module (BSCM) will have set a P0606 and C0021
Cause	Electrical anomalies during BSCM initialization may cause codes to set.

Correction:

To correct this concern, program the BSCM with the latest software available after January 3, 2020 in Tis2Web.

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
2886618*	Program BSCM	0.5 Hr.
* This is a unique labor operation for bulletin use only.		

Version History

Version	1
Modified	01/06/2020 - Created on.



GENERAL MOTORS

© 2020 General Motors. All Rights Reserved.