



# Preliminary Information

## PIT5635B Diagnostic Tip : Squeak / Rattle Noise from Rear of Vehicle Over Bumps Thought to be From the Leaf Springs.

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Colorado	2015 - 2020	All	All	All	All
GMC	Canyon	2015 - 2020	All	All	All	All

Involved Region or Country:	North America
Condition:	Squeak or rattle noise from the rear of the vehicle over bumps / washboard thought to be from the leaf springs.
Cause:	This noise can be caused by the rear brake pads shifting.

Correction:

Before servicing the leaf springs move the chassis ears to the rear brake backing plates. If the noise is isolated there, remove the rear brake pads and apply grease or anti-squeak compound to the rear of the pads and re-evaluate.

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation:	Description:	Labor Time:
<b>2420170</b>	<b>Remove And Reinstall Brake Pads</b>	<b>Use Published Labor Time</b>

Version History

Version	
	<b>3</b>
Modified	10/10/2018 - Created on. 08/14/2019 -Updated to include the 2020 model year. 01/10/2020 - Removed text regarding engineering investigation.

