

Bulletin No.: PIT5546G Published date: 01/28/2020

Preliminary Information

PIT5546G Dead Battery / P1682 P129D P10E4 P2535 / Crank No Start / Unable To Program ECM / Headlamp Water Intrusion / Engine Runs With Ignition Off

Product Investigation Review Required

<u>Models</u>

| Brand: | Model: | Model Years: | VIN: | | Engine: | Transmissions: |
|-----------|----------------|--------------|------|-----|---------|----------------|
| | | | from | to | Engine. | Transmissions. |
| Chevrolet | Silverado 1500 | 2016 - 2018 | All | All | All | All |
| Chevrolet | Silverado LD | 2019 | All | All | All | All |
| GMC | Sierra 1500 | 2016 - 2018 | All | All | All | All |
| GMC | Sierra Limited | 2019 | All | All | All | All |

| Involved Region or Country | North America |
|----------------------------|--|
| Condition | Some customers may comment on any of the following: - No crank - Dead battery - Crank no start - Unable to SPS program ECM - DTC P1682, P129D, P10E4 or P2535 - Engine stays running with ignition off While performing normal diagnostics, voltage may be found on any one of the following underhood electrical center fuses with the ignition off: F26UA, F31UA, F34UA, F39UA, F40UA, or F56UA. These fuses are switched ignition and should not have any voltage with the ignition off. This can cause multiple modules to stay awake and never go to sleep causing a dead battery. These concerns can be intermittent and may be more apparent during wet weather conditions. |
| Cause | Water intrusion into either of the headlamp assemblies, headlamp assembly connections, X110, or X120, could cause any one of the above conditions. |

Correction:

Inspect each headlamp assembly for water intrusion. If water intrusion is found, disconnect the appropriate headlamp assembly and evaluate the condition. If condition is alleviated, replace headlamp

assembly as necessary. If disconnecting the headlamp assembly does not alleviate the condition, check for water intrusion in the headlamp assembly connections, X110, or X120, and repair as necessary.

Version History

| Version | 8 |
|----------|---|
| | 01/27/2017 - Created |
| | 07/25/2017 - Added DTC |
| | 01/25/2018 - Updated model year |
| | 01/04/2019 - Updated model year |
| Modified | 02/01/2019 - Updated to add DTC P2535 |
| | 04/24/2019 - Updated to add keywords and change condition verbiage. |
| | 09/19/2019 - Updated to add DTCs to subject line. |
| | 01/28/20 - Updated to add X110 and X120 |
| | |



© 2020 General Motors. All Rights Reserved.