

Notice Information

Ref	13261
Posted Date:	
Posted To:	General Manager / Business Owner, Technician, Aftersales Manager, Service Leader / Advisor, Accounts / Admin
Subject:	Service/Technical

TOL NOTICE (US&CAN) – January 9, 2020
13261-SVC

TOL Ref. #

New Diagnostic Software Available for Download

Diagnostic software version **2020-1.1** is now available to download. Dealers should download this update from your Triumph Diagnostic Software page under the Service/Technical menu and begin using immediately.

- Please ensure all new bikes have the latest software downloaded at PDI.
- Please ensure all bikes being serviced have the latest software downloaded.
- Please ensure all relevant staff are informed of this update.

**** New password (case sensitive): Triple25**

SUMMARY OF CHANGES:

1)The instrument download process has been updated for Euro 5 compliant modern classic models with analogue/LCD instruments.

Background:Thruxton RS instrument packs are delivered in a locked condition and require a calibration download at PDI to unlock them. The instrument download process has been updated to support this.

1 **New Software Functionality:**

Note:it is still a requirement to remove the ABS fuse and place the engine stop switch in the STOP position before commencing instrument downloads on all modern classic models fitted with analogue/LCD instruments.

2)The download password has changed to**Triple25**(case sensitive)

2 **Engine ECM Calibrations:**

Bonneville Bobber TFC

- 030266-01
- 030267-01
- 030268-01

Rocket 3 calibrations for Thailand

- 031015-01 (Rocket 3 GT)
- 031021-01 (Rocket 3 R)
- 031027-01 (Rocket 3 TFC)

Street Triple S 660 cc

- 031036-01
- 031037-01

Thruxton RS

- 031006-01
- 031007-01
- 031010-01

3 Chassis ECM Calibrations:

None

Bonneville Bobber TFC:

- TYPE6-MPH-P22
- TYPE6-KMH-P22

Thruxton RS:

- 2570001_01-MPH-P26
- 2570003_01-KMH-P26

Note: Updating the instrument application software on the following Scrambler 1200 models from version 01.00 to version 02.19 will result in a 40 minute download time. This update is not mandatory unless installing a My Triumph Connectivity Module. Instrument calibrations containing application software version 02.19 must be downloaded when installing a My Triumph Connectivity Module.

Scrambler 1200 XC:

The following calibrations containing application software version 01.00 have been removed from service.

- INST00077
- INST00078
- INST00079

4 Instrument ECM Calibrations:

If updating Scrambler 1200 XC instruments in service, the following calibrations containing application software version 02.19 should be used:

- INST00092_CM
- INST00093_CM
- INST00094_CM

Scrambler 1200 XE:

The following calibrations containing application software version 01.00 have been removed:

- INST00080
- INST00081
- INST00082

If updating Scrambler 1200 XE instruments in service, the following calibrations containing application software version 02.19 should be used:

- INST00095_CM
- INST00096_CM
- INST00097_CM

5	Connectivity Module Calibrations:	None
6	Keyless ECM Calibrations:	None Bonneville Bobber TFC: 12222128
7	New ECU Unlock Codes:	Street Triple S 660 cc (A2): 62886187 Thrupton RS: 82822667
8	Calibration Description Corrections:	None Issues with unlocking the engine ECM on Rocket 3 GT, Rocket 3 R and Rocket 3 TFC are resolved.
9	Bug Fix(es):	Up to date keyless ECMs should now pass the calibration check process when unlocking the engine ECM. The following items are not supported for Thrupton RS models:
10	Known Issues In This Release:	<ul style="list-style-type: none"> • Autoscan • Fuel System 2 Status (Engine Diagnostics – Current Data) • Twist Grip Adapted Status (Engine diagnostics – Sensor Data – Engine Adaptions)

IMPORTANT NOTE: Additionally the following core technical documents have also been released to the Service/Technical > Service Technical Files section of Triumph Online (TOL):

MOTORCYCLE PREPARATION GUIDE

- Part 1 Unpacking – v15
- Part 2 Assembly Guides – v27
- Part 3 PDI Guides – v19

SERVICE CHECK SHEETS (600M First Service)

- 6000M – v2
- 10000M – v2

SERVICE DATA SHEETS

V23 to follow in the next few days due to a minor text anomaly

If you have any questions, please contact Triumph Customer Support at (888) 284-6288.