

**** SOLUTION ****

Title	Mack Chassis - Anthem (AN) - Hood Mounted Mirror Repair; Mirror Covers Loose, Rattling, Vibrating
-------	--

Mack Models

Mack Model	AN - Anthem
-------------------	-------------

**** SOLUTION ****

Cause	Mack Anthems with hood mounted mirrors may experience rattling or vibration from the mirrors. This may be due to worn tabs on the mirror covers.
-------	--


Solution	
----------	--

NOTE:

This modification is only valid for units built **Prior** to December 16 2019

Hood Mounted Mirror Modification

1. Lay out two 5/64" pilot holes on 2" centers 3/8" from the edge. A piece of painter's tape can be used to mark measurements.

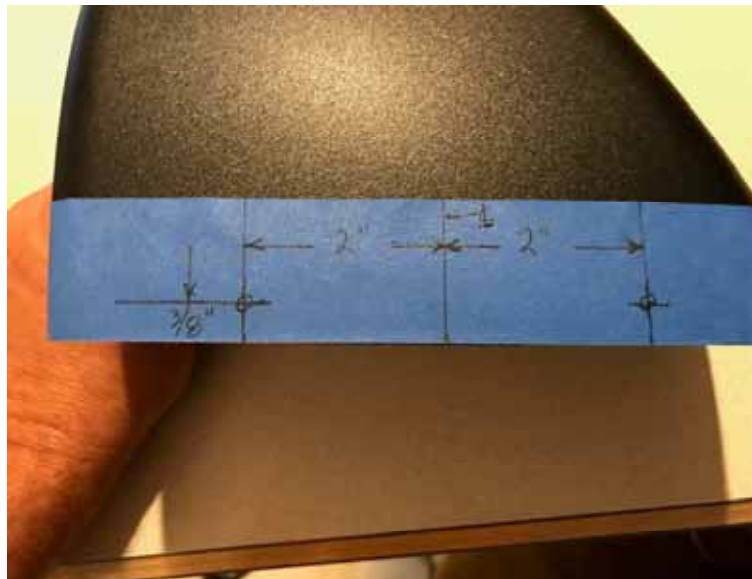

2. Transfer tape to the housing.
 - 2.1 Align centerline with the middle mounting tab inside the housing.
 - 2.2 Reinstall housing to the mirror.
 - 2.3 Drill two 5/64" pilot holes in the housing and the mirror body.



3. Remove housing and drill countersinks for #6-1/2 stainless steel screws.



4. Reinstall housing with original screw on the bottom and two (993622) screws at the top.

NOTE: Do not over tighten the screws.



Solution visibility	Dealer distribution
---------------------	---------------------

Function(s)/component(s) affected

Function affected	Mirrors
-------------------	---------

Function Group

Function Group	846 outside mirrors
----------------	---------------------

Customer effect

Main customer effect	noise , vibration
----------------------	-------------------

Noise	rattling noise
-------	----------------

Visual appearance	loose , wear
-------------------	--------------

Administration

Author	UT0783V
--------	---------

Dealer ID	UT0783V
-----------	---------

Last modified by	A241298
------------------	---------

Creation date	10-09-2019 15:09
---------------	------------------

Date of last update	16-01-2020 16:01
---------------------	------------------

Status	Published
--------	-----------

UNCONTROLLED COPY. Printed document is for temporary use only and should not be retained.