

SSM 48563 - 2017-2020 F-150 - No Crank/No Start, Multiple Illuminated Warning Indicators And/Or DTCs

Some 2017-2020 F-150 vehicles may exhibit a no crank/no start, auto start stop inoperative, illuminated malfunction indicator lamp (MIL) and/or powertrain malfunction indicator lamp, transmission shift concerns, diagnostic trouble codes (DTCs) P061A, U0140, U0401, U0101, U0074 and/or U0037 being set in the powertrain control module (PCM), transmission control module (TCM), instrument panel cluster (IPC), front controls interface module (FCIM), anti-lock braking system (ABS) module and/or power steering control module (PSCM). This may be due to the 15525 transmission wire harness not being properly secured. Visually inspect the harness for possible damage and proper routing at the rear of the engine down to the transmission. Repair as necessary. If no concerns are found, proceed with normal diagnosis.