



Thor Motor Coach Technical Service Bulletin

TSB #	TSB 20-01		
Description/Title:	Class B Van Bath Sink Hinge		
Affected Product Line(s):	Certain model year 2020 Sequence and Tellaro Class B Vans		
Service Campaign # :	RC000181	Released Date:	2/4/2020
Repair Codes:	Repair: TMCTS80257W	Document Date:	2/4/2020
Time Allowed:	Repair: 0.5	Document Revision:	A

Issue:

In certain model year 2020 Sequence and Tellaro Class B Vans, the bath sink hinge was cut, removing a portion of the E-coating. This can lead the hinge to prematurely rust.

The repair will require replacing the hinge and stainless screws.

Part(s) Required:

TMC Part Kit #0471299

Kit Includes:

One (1) Stainless Steel 11 ½” hinge


Fourteen (14) stainless steel screws

Shop Supplies:

Two (2) pieces of sealant tape

Instructions:

STEP 1: REMOVE THE SQUARE BIT SCREW FROM THE CABLE SUPPORT. (KEEP SQUARE BIT SCREW TO RE-ATTACH IN STEP 10.)

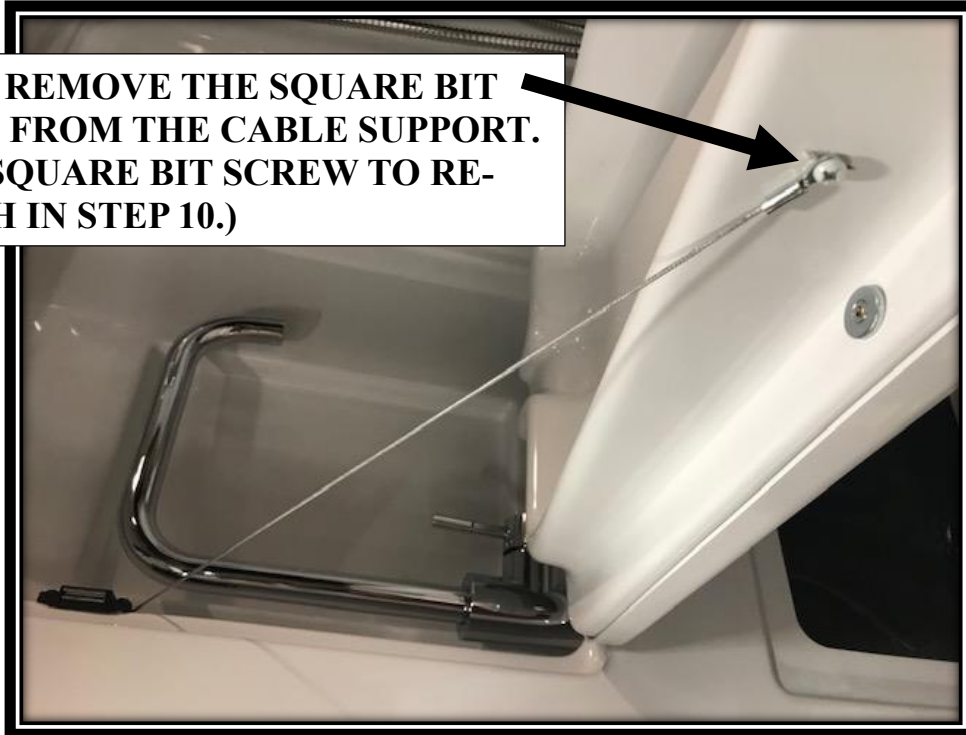

STEP 2: THIS WILL ALLOW THE SINK TO DROP AND REST ON THE STOOL.




STEP 3: REMOVE THE SIX SCREWS FROM THE DRAIN SIDE OF THE SINK. DISCARD SCREWS.




STEP 4: ONCE REMOVED, PLACE THE SINK BOWL ON A FLAT SURFACE AND REMOVE THE SIX SCREWS FROM THE BASIN. DISCARD HINGE AND SCREWS.



STEP 5: APPLY TWO STRIPS OF SEALANT TAPE ON EACH ½ OF THE NEW HINGE.

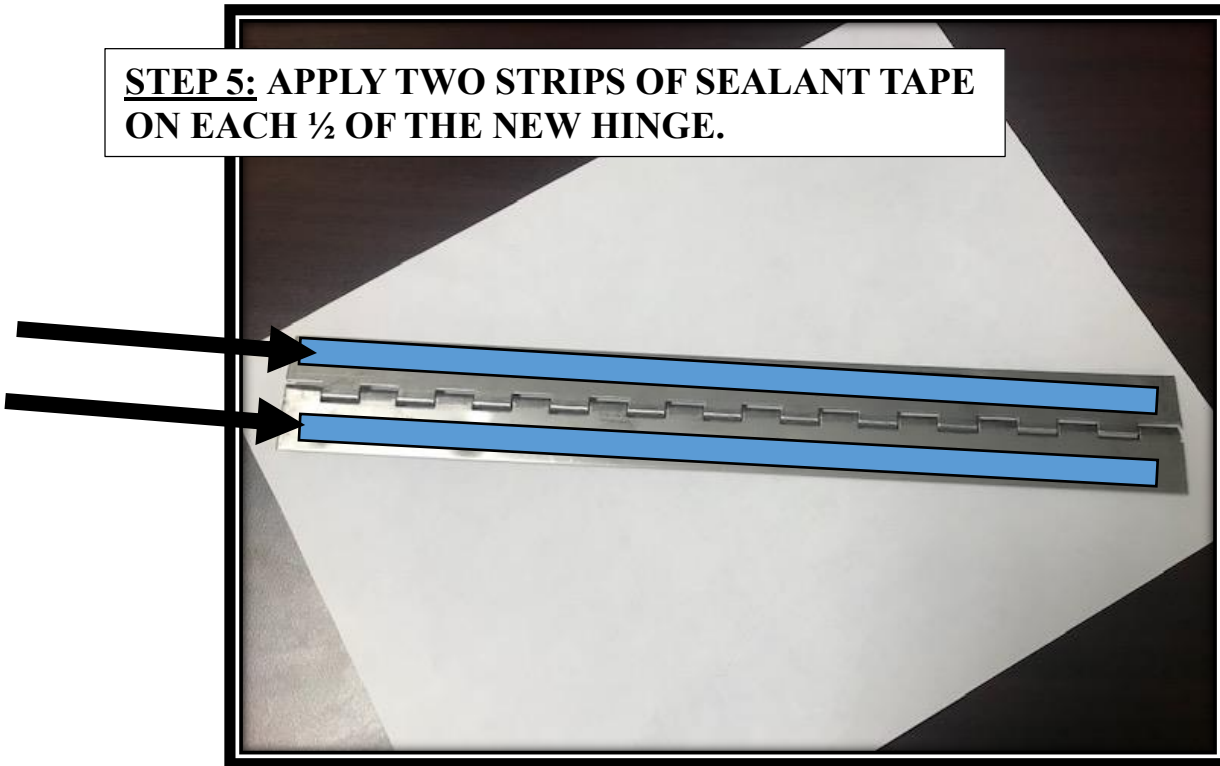

STEP 6: MARK A LINE ¼ INCH TO THE LEFT **OR RIGHT OF THE ATTACHMENT HOLES. YOU WILL NOT BE USING THE SAME HOLES TO ATTACH NEW HINGE.**

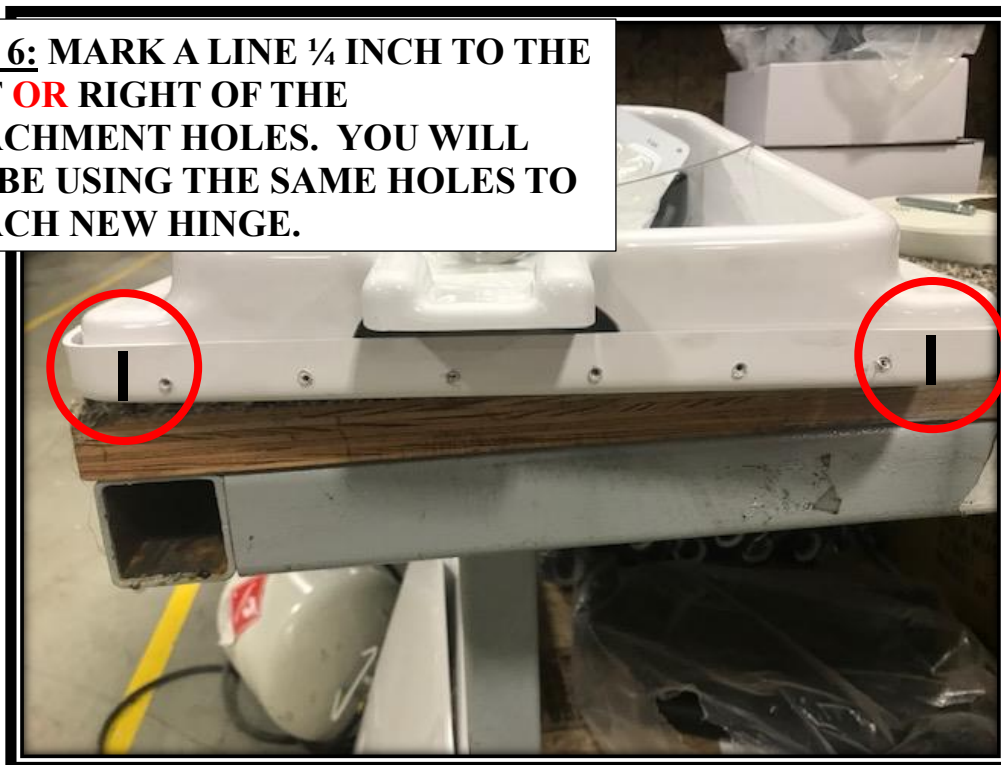

STEP 7: REATTACH THE NEW HINGE ONTO THE SINK BASIN USING THE SUPPLIED STANLESS STEEL SCREWS.



STEP 8: REST THE HINGE SIDE OF THE BASIN BACK ON TO THE DRAIN SIDE OF THE SINK AND REST IT ON THE STOOL.



STEP 9: REATTACH THE NEW HINGE TO THE DRAIN SIDE OF THE SINK USING THE SUPPLIED STAINLESS STEEL SCREWS.



STEP 10: REATTACH THE CABLE SUPPORT TO THE BASIN USING SQUARE BIT SCREW.

