Latest Vehicle Concern Fixes





Range Rover Sport Rattle / Buzz Noise

Customer Voice:

There is a rattle noise while driving.

Technical Description:

- The noise may appear to be originating from the instrument panel behind the
- The coolant pipe for the PCM may be contacting the body at the strut tower causing the noise.

- Install grommet LR052713 to the PCM coolant feed pipe assembly.
- The grommet lock surface of the grommet is to face away from the body surface.
- Reference SSM74722.

2019/2020 Range Rover and RR Sport MHEV equipped with AJ20P6











