

## LATEST VEHICLE CONCERN FIXES



### Misdiagnosis of DTC B00C1 Stored In OCS Module

Range Rover, RR Sport 14 -19MY  
Discovery 17 – 19MY

#### Customer Voice:

- A customer may report that the SRS warning lamp is illuminated.

#### Technical Description:

- A check of faults may find DTC B00C1-11, B00C1-12, B00C1-13 or B00C1-97 stored in the OCS module for the Passenger Seat Occupant Classification Sensor “ B “.

#### Status:

- These DTCs are often misdiagnosed as a fault with the OCS module.
- The Passenger Seat Occupant Classification Sensor “ B “ is the Belt Tension Sensor, which is part of the seatbelt reel assembly. It is mounted the side of the front passenger seat base frame.

