



Preliminary Information

PIC6404 Diagnostic Tip - Service Driver Assist, Steering Assist Reduced Messages, MIL illuminated with P25A2, U0265, U0566 setting

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Cadillac	CT4	2020	ALL	ALL	ALL	ALL
Cadillac	CT5	2020	ALL	ALL	ALL	ALL

Involved Region or Country	North America
Additional Options (RPO)	
Condition	Service Driver Assist, Steering Assist Reduced Messages, MIL illuminated
Cause	Loss of communication with the FCM, P25A2 (Brake System Control Module Requested Malfunction Indicator Lamp Illumination) U0265 (Lost Communication with Front View Camera - Windshield) U0566 (Invalid Data Received from Front Camera Module

Correction:

This failure should be infrequent.

If the concern is easily duplicated with all three DTC's - P25A2, U0265, and U0566 setting with Service Driver Assist, Steering Assist Reduced Messages, and MIL illuminated and the issue is occurring frequently replace the Front View Camera (Windshield).

A hardware and software correction will be released in the future for infrequently occurring cases.

Note: All three DTC's and the messages must occur together and be easily duplicated for Front View Camera replacement. If they occur separately, follow normal SI diagnostics.

This PI will be converted to a bulletin when further information is available.

Version History

Version	1
Modified	02/06/2020 - Created on.



GENERAL MOTORS

© 2020 General Motors. All Rights Reserved.