

Vehicle is temporarily unable to be locked or unlocked using Keyless-Go

Topic number	LI80.61-P-069912
Version	3
Function group	80.61 Keyless-Go/Keyless-Entry
Date	02-05-2020
Validity	Model series 167,177, 247 with code 889
Reason for change	updated model validity to include 167
Reason for block	

Complaint:

Vehicle may be temporarily unable to be locked or unlocked using Keyless-Go.

Cause:

May be due to the following causes:

1. Low frequency parameter of Keyless Go function. In this instance, the red LED in the key flashes on and off 3x.
2. Acceleration sensor in key. In this instance, the red LED in the key does not flash. The Keyless Go function is however rendered active again if the key is shaken.
3. The Keyless Go function on the transmitter key has been deactivated by a double-click - perhaps inadvertently. The red LED on the transmitter key does not flash. In this instance, the Keyless Go function is activated again when a button on the key is pressed.

Remedy:

1. Perform SCN coding of electronic ignition lock
2. Please create a PTSS case
3. Notify the customer accordingly

Symptoms
Overall vehicle / Safety and locking system / Keyless go / Function / Vehicle does not open
Overall vehicle / Safety and locking system / Keyless go / Function / Vehicle does not close using door handle