

Technical Service Bulletin

90 Instrument cluster: An oil change reminder is displayed

90 20 41 2058745/1 March 3, 2020.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment	
Audi e-tron quattro	2019	All	Not Applicable	

Condition

Customer states:

 A message requesting an "Oil change and inspection in ... miles" is displayed in the Audi virtual cockpit, even though this vehicle does not use or need oil (Figure 1).



Figure 1. Service message in the instrument cluster.

Technical Background

An incorrectly set adaption value in the instrument cluster causes the problem.

Production Solution

New ZDC in production starting with MY2020.

Service

- 1. Please perform the following procedure with ODIS, OBD >> 0017 Dash Board >> adaptation >> Service notification (RDID \$09C1) >> Change the value from 30 to 0 >> Apply.
- 2. After changing the parameter, only the message requesting an inspection (without oil change) should be displayed.



Technical Service Bulletin

Warranty

	1			
Claim Type:	• 110 up to 48 Months/50,000 Miles.			
	vner.			
	 If the vehicle is outside any warranty, this Technical Service Bulletin is informational only. 			
Service Number: 9025				
Damage Code:	0039			
Diagnostic Time:	GFF (OBD – Change adaption value)	0150 0000	Time stated on the diagnostic protocol (Max 20 TU)	
	Road test prior to the service procedure	No allowance	0 TU	
	Road test after the service procedure	No allowance	0 TU	
Claim Comment:	As per TSB #2058745/1			

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Additional Information

All part and service references provided in this TSB (2058745) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2020 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.