

Service Bulletin

Bulletin No.: 20-NA-031

Date: February, 2020

INFORMATION

Subject: Information on Malfunction Indicator Lamp (MIL) Illuminated - DTC P02CC, P02CD, P02CE, P02CF, P02D0, P02D1, P02D2, and/or P02D3 Set

Brand:	Model:	Model Year:		VIN:		Engine	Transmission:
		from	to	from	to	Engine:	Halisillission.
Chevrolet	Colorado	2018	2018			LWN	
GMC	Canyon					LVVIN	

Involved Region or Country	North America, Middle East		
	While the vehicle is in for service, some technicians may find one or more of the following DTCs re-setting in the Engine Control Module (ECM):		
	P02CC: Cylinder 1 Injector Exceeded Minimum Learning Limit		
	P02CD: Cylinder 1 Injector Exceeded Minimum Learning Limit		
	P02CE: Cylinder 2 Injector Exceeded Minimum Learning Limit		
Condition	P02CF: Cylinder 2 Injector Exceeded Minimum Learning Limit		
	P02D0: Cylinder 3 Injector Exceeded Minimum Learning Limit		
	P02D1: Cylinder 3 Injector Exceeded Minimum Learning Limit		
	P02D2: Cylinder 4 Injector Exceeded Minimum Learning Limit		
	P02D3: Cylinder 4 Injector Exceeded Minimum Learning Limit		
Information	After replacing the injectors, one or more of the DTCs may return. It may be necessary to replace the engine drive belt.		

Service Procedure

Refer to Drive Belt Replacement in SI.

Parts Information

Causal Part	Description	Part Number	Qty
N/A	BELT-GEN & A/ C CMPR	24580771	1

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
4062710	Drive Belt Replacement	Use the Published Labor Operations Time

Page 2 February, 2020 Bulletin No.: 20-NA-031

Version	1
Modified	Released February 14, 2020