



Mack LR OBD Connector Corrosion

Description:

Some Mack LR trucks equipped with a Cummins engine have the OBD connector located in a way that could allow moisture to collect and corrode the OBD connector.

Corrective Action:

Replace the knee bolster panel with PN 23580067 to relocate the connector. The wires to the OBD connector may need to be lengthened with pigtail 23656865. The pigtail comes pre-assembled with the necessary butt splices for installation.

UCHP SCC CODE: S7461

EXPIRATION DATE: 9/30/2020

CAUSAL PART NUMBER: 84722752

UCHP Labor Code:

1720-16-09-01 – Campaign, General – 1.0

PARTS MARKUP: 30%

PARTS LIST:

PN – Description – QTY

23580067 – COVER PANEL, KNEE BOLSTER, LH DRIVER – 1

23656865 – WIRES, OBD II JUMPER – 1

FOR MORE INFORMATION CONTACT: Sean Gallagher

sean.gallagher@volvo.com