

GPOP - Issue Review System

Part Number: 68354198A\$

Part Description: MODULE, Air Suspension, [SEB]

Issue Description: For replacement of Air Suspension Control Module (ASCM) due to the following DTCs, please contact *FCA Redacted Content* to aid in root-cause prior to repair at *FCA Redacted Content*

U0132 (Loss of Comm)
U0421 (Implausible Data)
C220C (Software Supervision)
C15DE-72 (Exhaust Solenoid Actuator Stuck Open)

If no response in 15 minutes, proceed with repair.

As per STAR Online case S1917000002: Do not replace any components. First record the DTC's by creating and saving a vehicle scan report with WiTECH under the reports tab. Next, attempt to reset the ASCM by removing the F50 20A ASCM fuse in the Power Distribution Center. Then reinstall the fuse. Using WiTECH check for DTC's. If U0132, U0421, U0422 DTCs are now stored, clear them. Perform a short test drive. If the codes do not return do not repair. Condition is under investigation by engineering.

~
Contact us at CAGRIS@Chrysler.com for feedback related ONLY to this GPOP Tech Tip. Please include the Part Number(s) and Tech Tip Part Description of the Tech Tip you are referencing for our tracking system.
