

## GPOP - Issue Review System

**Part Number:** 53034160A\$, 68043161A\$, 68044317A\$

**Part Description:** PEDAL, Accelerator (APPS)

**Issue Description:** Before replacing accelerator pedal for P061B, make sure all PCM software service bulletins and recalls are up to date, if applicable.

Before replacing accelerator pedal for other DTCs, be sure to follow fault code diagnostic procedures in Service Library and be sure to check wiring and connectors.

P2122 and P2127 will set if accelerator pedal connector is disconnected during diagnosis. Make sure codes are active before replacing pedal.

DTC P2299 is usually caused by a two footed driver and acceleartor pedal should not be replaced for this fault if driving style is confirmed with the customer.

~ \_\_\_\_\_ ~  
Contact us at [CAGRIS@Chrysler.com](mailto:CAGRIS@Chrysler.com) for feedback related ONLY to this GPOP Tech Tip. Please include the Part Number(s) and Tech Tip Part Description of the Tech Tip you are referencing for our tracking system.

---