



Service Bulletin

Bulletin No.: 19-NA-053

Date: February, 2020

TECHNICAL

Subject: Transmission Operation Concerns and/or Lack of Performance, Malfunction Indicator Lamp (MIL) Illuminated - DTC P0871 and/or P2714 Set

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Spark	2014	2020			All	CVT7 Automatic (M4M, MR8)

Involved Region or Country	North America, Middle East
Condition	<p>Some customers may comment on one or more of the following conditions:</p> <ul style="list-style-type: none"> • Transmission operation concerns • Transmission lack of performance • MIL illuminated <p>Some technicians may find one or more of the following DTCs set in the Transmission Control Module (TCM):</p> <ul style="list-style-type: none"> • P0871: Transmission Fluid Pressure Switch 3 System Performance • P2714: Pressure Control Solenoid Valve 4 Stuck Off—Hydraulic/Mechanical Problem
Cause	This condition may be caused by the transmission fluid pressure switch being contaminated with debris coming from the valve body.
Correction	<p>If you encounter a vehicle with the above concerns and find DTCs P0871 or P2714 set in the TCM, please clear the codes and road test the vehicle:</p> <ul style="list-style-type: none"> • If the DTCs do not reset, then no repairs should be performed and the vehicle can be returned to the customer. • If the DTCs set, then replace the transmission fluid pressure switch following SI. <p>If the vehicle was released to the customer because the codes did not set during the road test and later return with the same concerns, replace the transmission fluid pressure switch following SI procedure.</p>

Service Procedure

Refer to *Transmission Fluid Pressure Switch Replacement* in SI.

Parts Information

Causal Part	Description	Part Number	Qty
X	SWITCH, TRANS FLUID PRESS	25202299	1

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
8462370	Transmission Fluid Pressure Switch Replacement	Use Published Labor Operation Time

Version	2
Modified	Released March 14, 2019 February 17, 2020 – Added the 2020 Model Year and Middle East to Involved Region or Country section.

