Special Service Message

NOTE: A Special Service Message is a formal communication issued by Land Rover and carries the same importance of a Technical Service Bulletin. An SSM is a quick method of communicating "Need To Know" information to the technical service community. SSM's may be issued in advance of a technical bulletin or may be the only communication on a given topic. All information contained in Land Rover technical communications are intended for use by trained, professional technicians with the knowledge, tools, and equipment required to complete the procedure correctly and safely. It informs the Technicians of conditions that may occur on some vehicles, or provides information that could assist in correct vehicle and diagnostic service.

SSM 74764 - 18MY Onwards - TCU3 Remote App not working

Models : Discovery / L462 Discovery Sport / L550 Discovery Sport / L550 (Brazil 99J) Discovery Sport / L550 (China L2C) Evoque / L538 Evoque / L538 (Brazil 99J) Evoque / L538 (China L₂C) Evoque / L551 Evoque/L551 (China/L2C) Range Rover / L405 Range Rover Sport / L494 Range Rover Velar / L560 Engineer Mann Tom Name : Last 20 MAR 2020 15:22:17 **Modified** : **Category** : Electrical Symptom : 207000 Entertainment Systems Content : Issue: InControl Remote App does not update vehicle location or show correct vehicle status. Remote features (e.g.: Remote Engine Start, Beep and Flash, Remote Lock/Unlock etc.) do not work. Cause:

The Telematics Control Unit (TCU) unable to communicate with Telematics Service Provider due to curl library error.

Action:

- 1. Ensure Pathfinder tool is updated to the latest version.
- 2. Connect the JLR approved battery support unit the vehicle.
- 3. Connect the JLR approved diagnostic equipment to the vehicle and begin a new session.
- 4. Follow the JLR approved diagnostic equipment prompts.
- 5. Select 'ECU Diagnostics'.
- 6. Select 'Telematics Control Unit Module (TCU)'
- 7. Select 'ECU Functions'
- 8. Select 'TCU Module Reset'.
- 9. Follow all on-screen instructions to complete the task.
- 10. When all of the tasks are complete, exit the session.
- 11. Disconnect the JLR approved diagnostic equipment and the JLR approved battery support unit.

Jaguar Land Rover Limited 2000 - 2020 (Rel. 2678)