

TIGER 900 BATTERY COVER FITTING - EXTRA PDI CARE POINT



Notice Information

Ref	13967
Posted Date:	
Posted To:	General Manager / Business Owner, Technician, Aftersales Manager, Service Leader / Advisor, Accounts / Admin
Subject:	Service/Technical


TOL NOTICE (US&CAN) – March 5, 2020

TOL Ref. # 13967-SVC

Tiger 900 Battery Cover Fitting – Extra PDI Care Point

Dealership service staff should note an additional care point when fitting the battery cover on new Tiger 900 models. When fitting the battery cover it is important to ensure that the engine ECM harness is correctly routed and does not become trapped by the cover.

Examine the routing of the harness for the engine ECM. The image below shows the harness **loosely** routed. This can become trapped when you install the battery cover:

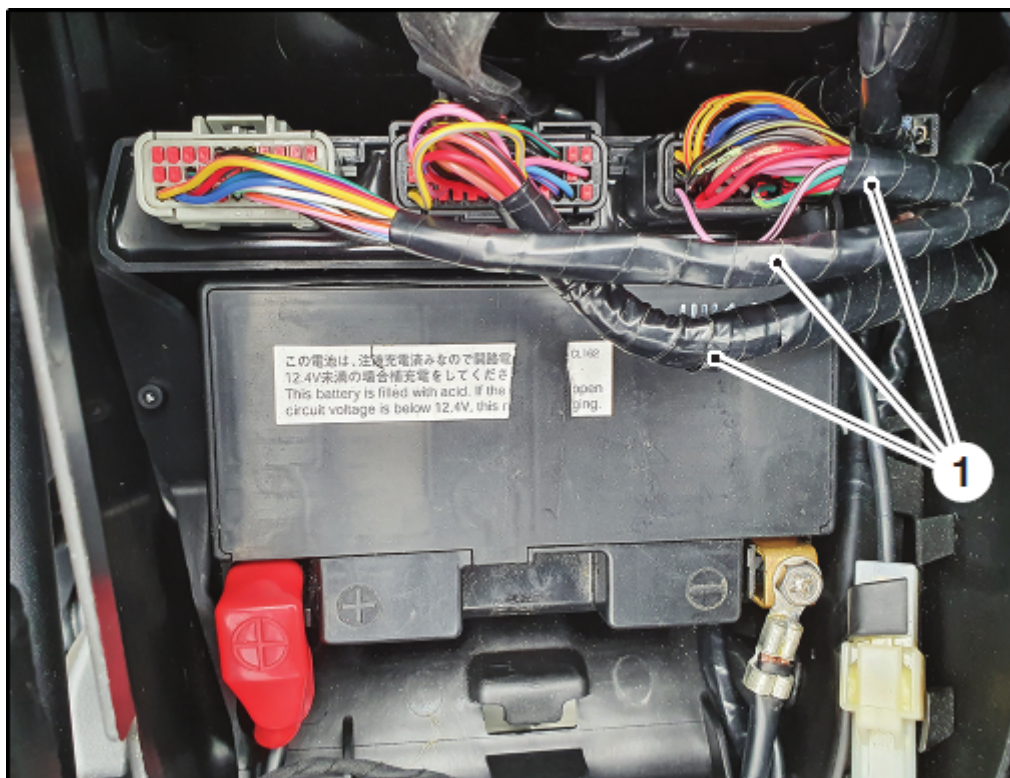


Technicians should take care to group the branches of the engine ECM harness together more tightly as shown in the image below:



Hold the branches of the harness together and install the battery cover. Be careful that the ECM harness wires do not become trapped by the cover.

Check that the three branches of the ECM harness exit from the conduit of the battery cover as shown below:

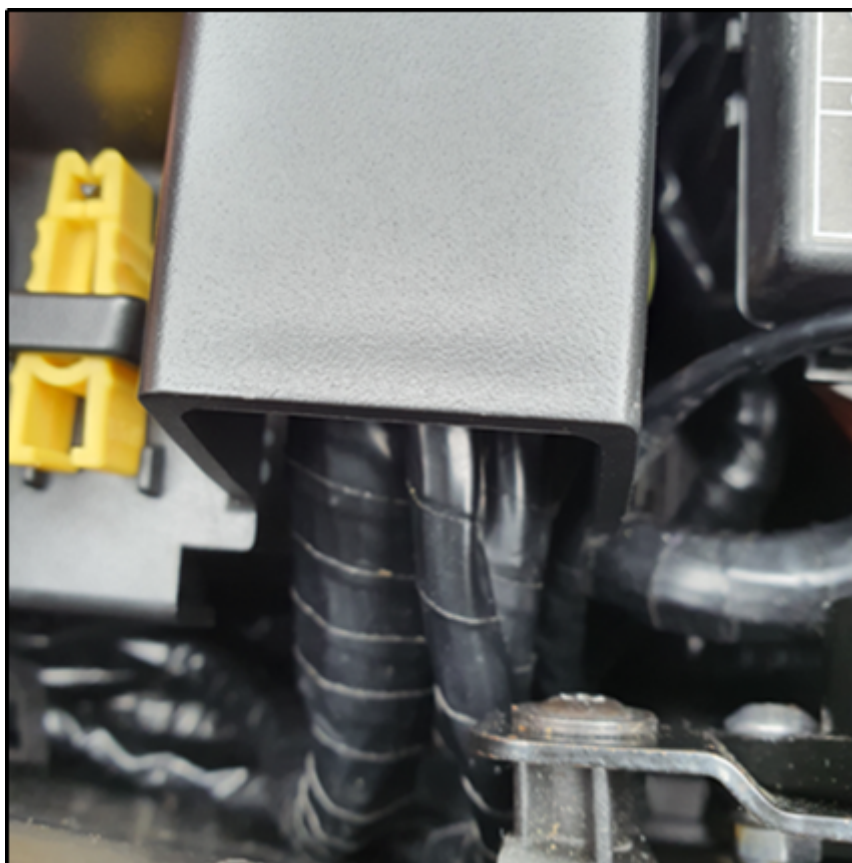

Attach the battery strap and continue to refit as described in the service manual. If you have any additional questions, contact Triumph Customer Support at (888) 284-6288.