

Technical Service Bulletin

94 Hazard warning lamps intermittently turn themselves on

94 20 22 2059217/1 April 10, 2020.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A8	2018	Neckarsulm only	Not Applicable
Q8	2019	Bratislava only	Not Applicable
A6, A7	2019	Neckarsulm only	Not Applicable

Condition

Customer states:

- Hazard warning lights activate on their own without input.
- Hazard lights may not be able to be switched off.

Workshop findings:

- No relevant DTC is stored.

Technical Background

Multifunction switch assembly can incorrectly detect input from the hazard switch.

Production Solution

Improved switch assembly installed in production.

Service

1. Confirm the customer concern using the battery history data. Battery history data can provide evidence that the hazard lights were actuated during a standing time.
2. If the time and date are close to the customer concern or the concern can be duplicated in service, replace the multifunction switch containing the hazard switch.



Tip: For customer concerns relating to false alarm activations, make sure to clarify with the customer if the alarm horn was heard or not. Alarm trigger data should be reviewed in these cases to ensure there is not another root cause.



Technical Service Bulletin

In these cases, this TSB does not apply continue with standard diagnosis.


Warranty

Claim Type:	<ul style="list-style-type: none">• 110 up to 48 Months/50,000 Miles.• G10 for CPO Covered Vehicles – Verify Owner.• If vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
Service Number:	9447		
Damage Code:	0010		
Labor Operations:	Remove and install multiple switch	9077 1950	See SRT
Diagnostic Time:	GFF	0150 0000	Time stated on the diagnostic protocol (Max 50 TU)
	Road test prior to the service procedure	No allowance	0 TU
	Road test after the service procedure	No allowance	0 TU
Claim Comment:	As per TSB #2059217/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Required Parts and Tools

Always check with your Parts Department and/or ETKA for the latest information and parts bulletins.		
Part Number	Part Description	Quantity
See ETKA	Fasteners, Bolts, Nuts, and Screws as needed per the Repair Manual	See ETKA/ELSA
See ETKA	Multiple Switch	01

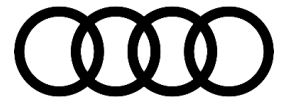

Technical Service Bulletin

Additional Information

All parts and service references provided in this TSB (2059217) are subject to change and/or removal.

©2020 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.