



Service Information

Offboard Diagnostic Information System Service (ODIS Service)

Number: VOS-20-13

Subject: Software Version Update, Enhancements and Fixes

Date: Apr. 15, 2020

Supersedes VOS-20-11 due to new diagnostic content version.

The following ODIS Service software versions are available for download.

| Current ODIS Service Software Versions | |
|--|------------------------------------|
| Application: V5.2.6 | Diagnostic Content: V2.40.1 |

Key Fixes/Enhancements for Diagnostic Content: V2.40.1:

1. AU - Golf 2013 – 2020

P204800: reductant injection valve circuit low bank 1

N474_XX_26_XXXX_1_0214_11_Dosierventil_Redmittel_00041 function test malfunction.

2. A3 - Passat/New Midsize Sedan 2011 – 2020, CPRA 1.8l Simos / 125 kW.

P001100: A Camshaft Position (Bank1) Timing over-advanced for System Performance test

J623_X_1_0918_11_X_ENW_Verstellung_pruefen_00011 malfunction.

- The following data could not be read: Intake camshaft phasing Bank1 test result - Send feedback once test has ended.

3. A3 - Passat/New Midsize Sedan 2011 – 2020, DDSA 2.0l Motronic / 130 kW.

P164D00: Reduced oil pressure switch Malfunction test

SYS_X_1_0715_11_X_X_SMG_OT_FSB_Schmierung_00000 does not provide a path if the ECM is the faulty component. There is no advised next steps if the issue is from the ECM

4. AU - Golf 2013 – 2020

No test created in Current Test Plan for ECM fault code P050700: Idle Control System RPM Higher than Expected.

5. A3 - Passat/New Midsize Sedan 2011 – 2020, CPRA 1.8l Simos / 125 kW.

Online coding of the front passenger door control module -J387-

J387_3C_94_____1_0909_11_codieren_asam_00011 incorrectly states that a road test is performed next via SVM.

6. General translation errors.