Service Information



Offboard Diagnostic Information System Service (ODIS Service) Number: VOS-20-14

Subject: Software Version Update, Enhancements and Fixes Date: Apr. 16, 2020

Supersedes VOS-20-13 due to new diagnostic content.

The following ODIS Service software versions are available for download.

Current ODIS Service Software Versions	
Application: V5.2.6	Diagnostic Content: V2.<mark>40.1</mark>

Key Fixes/Enhancements for Diagnostic Content: V2.40.1:

1. AU - Golf 2013 - 2020

P204800: reductant injection valve circuit low bank 1

N474 XX 26 XXXX 1 0214 11 Dosierventil Redmittel 00041 function test malfunction.

2. A3 · Passat/New Midsize Sedan 2011 – 2020, CPRA 1.81 Simos / 125 kW.

P001100: A Camshaft Position (Bank1) Timing over-advanced for System Performance test J623 X 1 0918 11 X ENW Verstellung pruefen 00011 malfunction.

• The following data could not be read: Intake camshaft phasing Bank1 test result - Send feedback once test has ended.

3. A3 · Passat/New Midsize Sedan 2011 – 2020, DDSA 2.01 Motronic / 130 kW.

P164D00: Reduced oil pressure switch Malfunction test

SYS_X_1_0715_11_X_X_SMG_OT_FSB_Schmierung_00000 does not provide a path if the ECM is the faulty component. There is no advised next steps if the issue is from the ECM

4. AU-Golf 2013 - 2020

No test created in Current Test Plan for ECM fault code P050700: Idle Control System RPM Higher than Expected.

5. A3 · Passat/New Midsize Sedan 2011 – 2020, CPRA 1.8 Simos / 125 kW.

Online coding of the front passenger door control module -J387-J387_3C_94____1_0909_11_codieren_asam_00011 incorrectly states that a road test is performed next via SVM.

Service Information



6. **7P Touareg 3.0L TDI/Hybrid 2010 - 2015**

Touareg 3.0L TDI ECM and HV control module communication errors: Connection

- LL_EnginContrModul1UDS could not be opened. ECF_OPEN_LOGICAL_LINK_FAILED.
 - The control module communication errors occur while performing ECM and HV functions, adaptations or basic settings.

7. General translation errors.