



Service Bulletin


Bulletin No.: 20-NA-062

Date: March, 2020

TECHNICAL

Subject: Intermittent Slips in Reverse and/or No Reverse

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Colorado	2019	2020				MYB
GMC	Canyon						

Involved Region or Country	North America
Condition	Some customers may comment that the transmission intermittently slips and/or does not engage when shifted into reverse.
Cause	 <p style="text-align: right; font-size: small;">5539394</p> <p>This condition may be caused by a rough finish on the center support housing damaging the low-reverse piston seal.</p>
Correction	Replace the reverse piston seal and the center support.

Service Procedure

Refer to *Center Support, Output Carrier and Output Shaft Removal (6L50)* and *Center Support, Output Carrier and Output Shaft Installation (6L50)* in SI.

Parts Information

Causal Part	Description	Part Number	Qty
X	SUPPORT, CTR	24257088	1
N/A	PISTON, LOW & REV CLU	24225525	1

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
8466150	Center Support Replacement	Use the Published Labor Operations Time

Version	1
Modified	Released March 10, 2020

