



# Service Bulletin

Bulletin No.: 20-NA-035

Date: March, 2020

## TECHNICAL

**Subject:** Wind Whistle Noise from Front of Vehicle While Driving

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
GMC	Sierra 2500HD/ 3500HD	2020	2020			All	All

<b>Involved Region or Country</b>	North America, Middle East, Israel
<b>Additional Options (RPOs)</b>	
<b>Condition</b>	Some customers may comment on hearing a whistling noise coming from the front of the vehicle while driving. The condition is most commonly heard when vehicle is traveling 50 mph (80 kph) and higher, but also may be affected by crosswinds, so it may be intermittent.
<b>Cause</b>	The cause of the condition may be air turbulence under the front edge of the hood, which causes a whistle noise.
<b>Correction</b>	<div style="text-align: center;"> </div> <p style="text-align: right;">5523506</p> <p>For vehicles exhibiting this Condition, replace the hood front edge weatherstrip and molding with updated service parts. Refer to <i>Hood Front Molding Replacement</i> in SI.</p>

## Parts Information

Causal Part	Description	Part Number	Qty
X	WEATHERSTRIP ASM-HOOD FRT EDGE	84769113	1
	MOLDING ASM- HOOD FRT (CHROME)	84774163	1
	MOLDING ASM- HOOD FRT (BLACK)	84774164	

## Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
1011750	Hood Front Molding Replacement	Use Published Labor Operation Time

Version	1
Modified	Released March 04, 2020

