



# Service Bulletin

Bulletin No.: 20-NA-075

Date: March, 2020

## INFORMATION

**Subject:** Information on No Malfunction Indicator Lamp (MIL) Illuminated, Ignore These DTCs if Set in History

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Corvette	2020	2020			All	All

Involved Region or Country	North America, Middle East
Condition	Though customers do NOT see any MIL illuminated, a technician may comment on finding DTCs set in History. The DTCs may include any number of DTCs listed in the table below.
Cause	<ul style="list-style-type: none"><li>If any of the DTCs listed in the table below are <b>set in History</b>, and there is <b>NO customer concern</b>, they have no customer impact and should be ignored.</li><li>If these DTCs are <b>Currently set</b>, do NOT ignore them, but diagnose as normal.</li></ul>
Correction	<b>A correction will be released at a later date.</b>

### DTCs to Ignore

Module	DTC #	Description
Front Lift System	U0402.00	Invalid Data Received from Transmission Control Module
Telematic Control Module	U0146.00	Lost Communication with Central Gateway Module
Passenger Presence Module	U0422.00	Invalid Data Received from Body Control Module
Video Processing Module	U3002.56	Vehicle Identification Number - Invalid or Incompatible
Audio Amplifier	U1008.29	Loss of Ethernet Link Signal Invalid
Radio	U3000.4B	Control Module Over Temperature
Instrument Panel Cluster Control Module	U0131.00	Lost Communication with Electronic Power Steering
Brake System Control Module	U0131.00	Lost Communication with Electronic Power Steering
Brake System Control Module	U0151.00	Lost Communication with Inflatable Restraint Sensing and Diagnostic Module
Brake System Control Module	U0132.00	Lost Communication with Active Leveling Control Module
Brake System Control Module	U0139.00	Lost Communication with Suspension Control Module
Driver Seat Adjuster Memory Module	U0209.00	Lost Communication with Seat Bolster Memory Control Module Driver
Front Lift System	C103C64	Left Front Strut Position Sensor Signal Signal Plausability

Module	DTC #	Description
Front Lift System	C103E64	Right Front Strut Position Sensor Signal Signal Plausability
Passenger Presence Module	U0401.00	Invalid Data from Engine Control Module
Body Control Module	B1A5F	Front Enclosure Entrapment Release Switch Signal Short to Battery or Open

## Parts Information

No parts are required for this repair.

Version	1
Modified	Released March 20, 2020

