



Service Bulletin

Bulletin No.: 20-NA-076

Date: April, 2020

INFORMATION

Subject: Information on Fuel Injector Flow Rate Identifier Labels

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Silverado 1500	2020	2020			LM2	
GMC	Sierra 1500						

Involved Region or Country	North America
Condition	The injector flow rate identifier is stored in the engine control module. This identifier is written on the injector and indicates the actual flow rate for this specific injector. This is used to compensate manufacturing tolerances of the injectors.

Information



5567788

The OEM Engine has an injector flow rate identifier label located on the side of the charge air cooler. This sticker is only valid as long as all original 6 injectors are still installed in the engine. If a fuel injector or engine replacement is required, this label must be removed and discarded. The service engine comes with new fuel injectors and a new flow rate identifier label.



5568473

The Service Engine has an injector flow rate identifier label located on the side of the camshaft cover. This label is only valid as long as all original 6 injectors are still installed in the engine. If a fuel injector requires replacement the label must be removed and discarded.



5568478

If the injector flow rate identifier labels have been removed from the OEM and/or Service engine, use the injector flow rate identifier written on each injector

Parts Information

No parts are required for this repair.

Version	1
Modified	Released March 27, 2020

