

CAMPAIGN LAUNCH STATUS

UPS N452 – 20MY L550 DISCOVERY SPORT VEHICLE RANGE DISPLAY



UPDATE PRIOR TO SALE N452 – INSTRUMENT CLUSTER RANGE DISPLAY INACCURATE

AFFECTED MODELS	2020 MY DISCOVERY SPORT -MIDLINE INST PACK
VOLUME AFFECTED	894 USA 14 CAN
REPAIR	Affected vehicles require a software update to the Instrument cluster.
REPAIR TIME	0.2 hrs + Drive in/out
REPAIR LAUNCHED	April 1 st 2020

- The Midline cluster software incorrectly interprets a reset of the “Fuel Consumption” signal at vehicle start up as fuel consumed and incorrectly calculates fuel economy is poorer than actually achieved, leading to incorrect low calculation of range display.
- The Fuel gauge display and low fuel warning are not affected.
- All affected vehicles are unsold and require this update prior to sale and delivery. Retailers can run reports of vehicles in their inventory in British Brand Sales Suite, (BBSS)