LATEST VEHICLE CONCERN FIXES

POWERTRAIN





Engine Cooling Fan runs at full speed

2018 onwards Discover Sport, RR Evoque, RR(PHEV), RR Sport (PHEV), RR Velar, F TYPE, F PACE, E PACE, XE, XF equipped with AJ20P4

Customer Voice:

- There is a loud noise from the front of the vehicle.
- The Check Engine MIL is on.

Technical Description:

- DTCs P26CB-72 and/or P2B61-73 may be present.
- The slide mechanism for the variable pump is sticking and 100% duty cycle of the fan is normal operation.

Status:

- A revised coolant pump design and PCM software update will be released in the coming weeks to resolve this complaint.
- ICA hardware is available currently.
- PCM software has entered a staggered deployment beginning with Pathfinder 270. The schedule is due to have all software released by the end May 2020.
- Once the hardware and software release are complete, JLRTB02030NAS1 will be published.











