

### Subject:

CONNECTED VEHICLE SYMPTOM TROUBLESHOOTING

Service Alert No.: SA-031/20

Last Issued: 04/02/2020

## **BULLETIN NOTES**

This service alert supersedes the previously issued service alert listed below. The changes are noted in Red text.

Previous Service Alert	Date(s) Issued:
SA-031/20	03/11/20 and 02/27/20

### **APPLICABLE MODEL(S)/VINS**

2020 CX-30

# DESCRIPTION

Some customers may complain about any of the following:

- Vehicle Center Display does not provide the One Time Pass Code during the MyMazda App Connected Vehicle enrollment.
- Remote function(s) inoperative.
  - Engine Start / Stop
  - Door Lock / Unlock
  - Lights ON / OFF

Confirm the customer's phone and vehicle have good to strong reception during the concern as shown in the table below.

- If the reception is weak, move the vehicle to a location where the reception is good to strong as shown in the table, then try to get the One Time Pass Code and/or operate the remote functions before proceeding to the Repair Procedure if there is still an issue.
- If the reception is good to strong, proceed to the Repair Procedure.

#### Page 1 of 6

**CONSUMER NOTICE**: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

	FM       HORadio 1.2.3         Dwnld Radio.com Now!       93.1 JACK FM         93.1 JACK FM - Playing What We Want
Indication	Explanation
the second se	Radio waves are not being received. Move to a location with good reception.
	Weak reception.
	Good Receptioin
	Strong reception.
the second se	Currently conducting an operation check of the communication unit. If this condition continues, consult an Authorized Mazda Dealer.
	The communication unit is unsubscribed or a Connected Service contract has ended.

#### Remote Engine Start Will Not Function under the following conditions

Item	Condition
1	Vehicle battery voltage low
2	AT shift position except "P"
3	Vehicle speed above 3 mi/h (5 km/h)
4	Brake pedal switch malfunction
5	Engine already started by remote engine start function
6	A registered key is detected in the vehicle
7	Brake pedal switch detects brake application
8	Low fuel warning message

## Page 2 of 6

**CONSUMER NOTICE:** The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

9	Engine starts, then turns OFF due to abnormal high engine rpm detected. (Engine rotation over 3000 rpm continued for more than 0.2[s])
10	No engine rpm detected after sending engine start request. (Engine rotation 0 rpm continued for more than 0.2[s])
11	When the CAN data signal for engine shut off is present (e.g.: door ajar signal)
12	After 10 second maximum cranking time
13	Burglar alarm status is "Alarm" and "Alarm stand by" (CAUTION - DO NOT enable, see Theft- Deterrent System section in SA-013/20)
14	Room fuse blown/missing
15	Connected Vehicle Maintenance Mode enabled (Restricted Transmitting Mode in MDARS)

### Remote Engine Start Function Will turn engine OFF under the following conditions

Item	Condition
1	Vehicle door(s) opened
2	Vehicle trunk opened
3	Vehicle hood opened
4	Ignition switch push button "ON" detected
5	Remote engine STOP request
6	Brake pedal switch detects brake application
7	CHECK ENGINE light ON
8	After 15 minute run time limitation

# **REPAIR PROCEDURE**

**NOTE:**Vehicles stored for long periods may loose GPS clock sychronization. If the vehicle is stored for a long period, test drive the vehicle to give the GPS clock time to sychronize before enrolling or testing connected vehicle functions .1. Verify customer concern.

2. Use MDARS to ID the vehicle and check for DTC's stored. **Are DTC(s) stored?** 

- Yes Go to step 3.
- No Go to ODR Data Collection Procedure, then go to step 3.

3. Retrieve MAZDA CONNECT CMU log data. Go to MGSS MAZDA CONNECT CMU Data Retrieval 4.Clear DTC(s).**NOTE:** If DTC 2050:55 is stored, go to SA-003/20 to clear DTC.5. Perform KAM reset.

Page 3 of 6

**CONSUMER NOTICE**: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

Service Alert No.: SA-031/20	Last Issued: 04/02/2020

**NOTE:**Test drive vehicle after a KAM reset to allow the GPS clock to sychronize before retrying connected vehicle functions.6. Contact Hotline for the latest repair information.

### ODR Data Collection Procedure

1. ID the vehicle								
using MDARS								
	Wate Degreete and	Arguer Submere BIDARD			O depruzale	R VIN JALEPANAG	â	- 0 × 421 1 1 1 1 1 1 1 1
			104		-	-	VOK	
2. Select "Toolbox"	ADD .	NHW SINY	ccu	ONU	DANKERN		isc.	198.
	COOR ESSED	DOOR_SERLIP	inc.	(PS)	150	rsee	isit	acces
		105	104	99.	POR			
	No DTCs	RM Communication Er	ror No Comm	nunication or Not	Equipped	C(s) exist	lot Supported	
		Toolbox			<b>O</b> dgoezate (	🖨 vin Jaiepanask	ð	(CC) (1) (1) (1) (1) (1) (1) (1) (1) (1) (1
		ologger				Not Ru	n	l ♥   ♠ Run
3. Select Vehicle	+ On-den	uation test for system nand self-test onal records	n operation					
lcon	and the second	icle History				Not Ru	n	Ran

#### Page 4 of 6

**CONSUMER NOTICE:** The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

	Marcla Dispersiti and Repair Scheme (MCARL)				- 0 x
	⊖ mazoa	\rm O dgonzale	A VIN: JALEPANAKK	2 10	13.8v 🚍
	📾 Quick Check 🗶 Toolbox				
	<u> </u>				¥   A
	+ BRAKES				
	+ TRANSMISSION/TRANSAXLE				
4. Select "Collect	+ RESTRAINTS				1
Diagnostic	+ SEATS				_
Information"	+ SECURITY AND LOCKS				
mormation	+ LIGHTING SYSTEMS				
	+ WIPER/WASHER SYSTEM				
	+ POWER SYSTEMS				
	+ i-ACTIVSENSE				
	+ Mazda Connect				
	+ Collect Diagnostic Information				
	Service ressory		Not Run		Rus
	Mutta Degreetic and Repar Software (MOARS)				- II X
	⊖ mazoa	<b>O</b> dgonzale	A VIN: JMIBPANANCK	20	1 🖬 IIN 🚍
	Quick Check X Toolbox				
	<u>ਨ ਬ </u>				1 1
					¥ 😣
	La Loning States			_	¥ *
					* *
5. Select Collect	Continue statema				¥   A
	CONTINUESTATENTS     WIPER/WASHER SYSTEM				* *
Diagnostic	CONTINUESTATEMIS     WIPER/WASHER SYSTEM     POWER SYSTEMS				* *
5. Select Collect Diagnostic Information "Run"	CONTINUE STATEMS     WIPER/WASHER SYSTEM     POWER SYSTEMS     i-ACTIVISENSE		*		
Diagnostic	CAUTTING STSTEMS      WIPER/WASHER SYSTEM      POWER SYSTEMS      i-ACTIVSENSE      Mazda Connect		Notifs		Run
Diagnostic	Counting attacks     WIPER/WASHER SYSTEM     POWER SYSTEMS     I-ACTIVEENSE     Mazda Connect     Collect Diagnostic Information		Not Run Not Run		
Diagnostic					Run
Diagnostic	COURTINNS STATEMS      WIPER/WASHER SYSTEM      POWER SYSTEMS      I-ACTIVSENSE      Collect Diagnostic Information      I-ACTIVSENSE analysis mode setting      I-ACTIVSENSE analysis mode release		Not Run		Run
Diagnostic	CONTINUES STATEORS     WIPER/WASHER SYSTEM     POWER SYSTEMS     I-ACTIVSENSE     Gollect Diagnostic Information     I-ACTIVSENSE analysis mode setting     I-ACTIVSENSE analysis mode release     Manual trigger mode setting		Not Run Not Run		Run

## Page 5 of 6

**CONSUMER NOTICE**: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

Service Alert No.: SA-031/20	Last Issued: 04/02/2020

	Collect Diage- X  ODR Collection  Verify the following conditions are met before continuing this procedure.	😧 dgoruzale   🚔 VIN: JMEBYNAMMEK	8	(12)	- D	×
	Ignition Condition : On Current value : On		-	~	Next	
6. Turn Ignition ON,	Matta Degrade and Rept Software (MDR3)			1		/
then select "Next"	⊖ mazoa	\varTheta dgonzale   🚔 Vite JM1BEWNAMAK	8	(121)	13.84	=
	🖬 Quick Check 🕺 Toolbox 🖙 Collect Diag- 🗙					
	ODR Collection					
	✓ ODR collection has been successful.					

Page 6 of 6

**CONSUMER NOTICE**: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.