



|   |                                   |   |
|---|-----------------------------------|---|
|  <b>HYUNDAI</b><br><b>Technical Service Bulletin</b> | <b>GROUP</b><br><b>Body</b>       | <b>NUMBER</b><br><b>20-BD-010H</b>  |
|   | <b>DATE</b><br><b>April, 2020</b> | <b>MODEL(S)</b><br><b>Accent (RB),<br/> Elantra (MD/UD),<br/> Azera (HG), Sonata<br/> (LF/LFa), Sonata<br/> Hybrid (LF HEV)</b> |
| <b>SUBJECT:</b> TRUNK LATCH BASE REPLACEMENT  |                                   |   |

**Description:** The trunk latch base can be ordered separately from the trunk latch assembly. This bulletin describes the procedure to replace the trunk latch base.

**Applicable Vehicles:** Certain 2014 – 2017MY Accent (RB), 2013 – 2016MY Elantra (MD/UD), 2015 – 2017MY Azera (HG), 2015 – 2017MY Sonata (LF/LFa), and 2015 – 2017MY Sonata Hybrid (LF HEV) vehicles.

**Parts Information:**


| Model                                      | Part Number    | Part Name  |
|--|----------------|--|
| Accent (RB)                                | 81231-1R020FFF | <br>Trunk Lid Latch Base |
| Elantra (MD/UD) - Power                    | 81231-3X010FFF |  |
| Elantra (MD/UD) - Manual                   | 81231-3X000FFF |  |
| Azera (HG)                                 | 81231-C1000FFF |  |
| Sonata (LF/LFa),<br>Sonata Hybrid (LF HEV) | 81231-C1010FFF |  |

**Warranty Information:**


| MODEL   | OP CODE  | OPERATION                     | OP TIME | CAUSAL PART  | NATURE CODE | CAUSE CODE |
|---|----------|-------------------------------|---------|--|-------------|------------|
| Accent (RB)<br>Elantra (MD/UD)<br>Sonata (LF/LFa)<br>Sonata Hybrid (LF HEV) | 81231F01 | Trunk Latch<br>Partial Repair | 0.3 M/H | Refer to the<br>table above<br>for the<br>applicable P/N | I11         | ZZ3        |
| Azera (HG)  | 81231F02 | Trunk Latch<br>Partial Repair | 0.4 M/H |  |             |            |

**Service Procedure:**

1. Remove the trunk latch assembly according to the applicable vehicle shop manual.

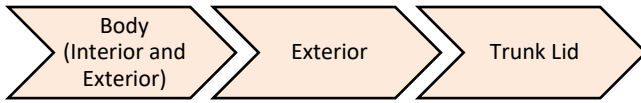

2. Remove the four trunk latch assembly screws.

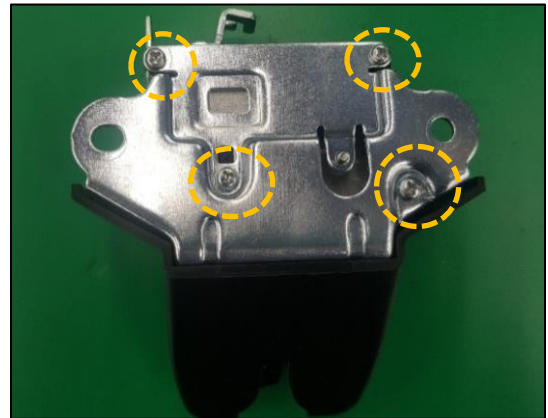

3. Replace the trunk lid latch base and reuse the actuator.

**CAUTION**

When reusing the actuator, do not contaminate the motor area.



Latch Base



Actuator

4. Reinstall the removed parts in reverse order of removal.
5. After reassembly, verify that the trunk operates normally.
6. The service procedure is now complete.