



Preliminary Information

PIC6339C Diagnostic Tip - Service Driver Assist message B290A

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Cadillac	CT6	2018 - 2020	All	All	All	All

Involved Region or Country	North America
Additional Options (RPO)	UKL
Condition	Service Driver Assist message With a B290A SYM49
Cause	Steering wheel Lane Centering Indicators Ram Error

Correction:

If a B290A SYM49 is found to be setting current, it will be necessary to unplug the Steering Column Friction Control Module (SCFCM) and recheck the status of the DTC.

If after unplugging the SCFCM the B290A remains current, the Steering Wheel will require replacement. If the B290A changes to history, the Steering Column Friction Control Module will require replacement.

Version History

Version	4
Modified	09/14/2018 - Created 05/08/2019 - Removed reference to PIC6307 02/04/2020 - Added 2020 Model Year 04/20/2020 - Updated Keywords and Title

