



Technical Journal

TITLE:

Roller blind, rattle noise when opening

| | | | |
|--|---|--|-----------------------------------|
| REF NO: TJ 33183.3.0 | ISSUING DEPARTMENT: Technical Service | CAR MARKET: United States and Canada | |
| PARTNER: 3 US 7510 Volvo Car USA | | ISSUE DATE: 2020-04-21 | STATUS DATE: 2020-04-24 |
| FUNC GROUP: 8364 | FUNC DESC: Sun visor, roof hatch | Page 1 of 6 | |

“Right first time in Time”

Attachment

| File Name | File Size |
|------------------------------|-----------|
| TJ 33183.mp4 | 3.8060 MB |
| TJ 33183.jpg | 0.0167 MB |
| TJI-519080-1_1_0_en-US.pdf | 0.2766 MB |

Vehicle Type

| Type | Eng | Eng Desc | Sales | Body | Gear | Steer | Model Year | Plant | Chassis range | Struc Week Range |
|------|-----|----------|-------|------|------|-------|------------|-------|-----------------|------------------|
| 225 | | | | | | | 2019-9999 | | 0000001-9999999 | 201817-999952 |
| 227 | | | | | | | 2019-9999 | | 0000001-9999999 | 201846-999952 |
| 235 | | | | | | | 2017-9999 | | 0000001-9999999 | 201624-999952 |
| 236 | | | | | | | 2017-9999 | | 0000001-9999999 | 201646-999952 |
| 246 | | | | | | | 2018-9999 | | 0000001-9999999 | 201717-999952 |
| 256 | | | | | | | 2016-9999 | | 0000001-9999999 | 201505-999952 |

CSC Customer Symptom Codes

| Code | Description |
|------|---|
| B2 | Sun/moon/convertible roof/Squeak/rattle |

VST Operation Number

| VST Operation Number | Description |
|----------------------|---|
| 98750-2 | Electric motor sun blind roof hatch adjust acc. to TJ 33183 |



DTC Diagnostic Trouble Codes

Rows beginning with * are modified

Note! If using a printed copy of this Technical Journal, first check for the latest online version.

Text

DESCRIPTION:

If a vehicle with panorama roof shows symptom of a rattling noise from roller blind when opening, follow the description under Service.

SERVICE:

* If the analysis shows that the rattling noise comes from the roller blind, install a gasket inside the roller blind motor according to the attached TJ instruction.

* PN 11998 (1 piece)

VEHICLE REPORT:

Yes, please submit a Vehicle Report if the service solution described in this TJ has no effect. Use concern area "Vehicle Report" and sub concern area "Support not needed", use function group 8364.

To view TJ attachments continue to next page. This TJ has 2 attachments and one sound file.



TJ 33183



Volvo Car Customer Service

TJ Instruction VCC-519080-1

| | | | |
|---------------|--------------------------------|--------------------------|---------|
| Title | Sun visor/inner cover sun roof | Page | 1 (3) |
| Action | Adjustment | Operation number: | 98750-2 |

| Issue | Date | Reason |
|--------------|-------------|---------------|
| 1 | 2020-04 | First issue |


Affected vehicles

| Model year | Model |
|------------------------------|-------------------------|
| 2019, 2020 | V60 (19-) |
| 2019, 2020 | V60 Cross Country (19-) |
| 2017, 2018, 2019, 2020 | V90 (17-) |
| 2017, 2018, 2019, 2020 | V90 Cross Country |
| 2018, 2019, 2020 | XC60 (18-) |
| 2016, 2017, 2018, 2019, 2020 | XC90 (16-) |

Materials

| Materials | Qty. | Part No. | Notes |
|------------------|-------------|-----------------|--------------|
| Gasket | 1.0 | 11998 | |

Color symbols

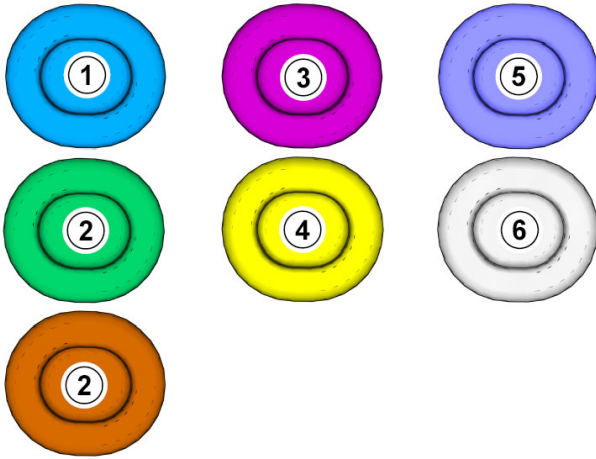

Note! This colour chart displays (in colour print and electronic version) the importance of the different colours used in the images of the method steps.


- 1 . Used for focused component, the component with which you will do something.
- 2 . Used as extra colors when you need to show or differentiate additional parts.
- 3 . Used for attachments that are to be removed/installed. May be screws, clips, connectors, etc.
- 4 . Used when the component is not fully removed from the vehicle but only hung to the side.
- 5 . Used for standard tools and special tools.
- 6 . Used as background color for vehicle components.

Removal

Remove the headlining , refer to:
Removal, replacement and installation
8 - Body and interior
85 - Interior
855 - other upholstery

Installation

Use: Gasket , 11998

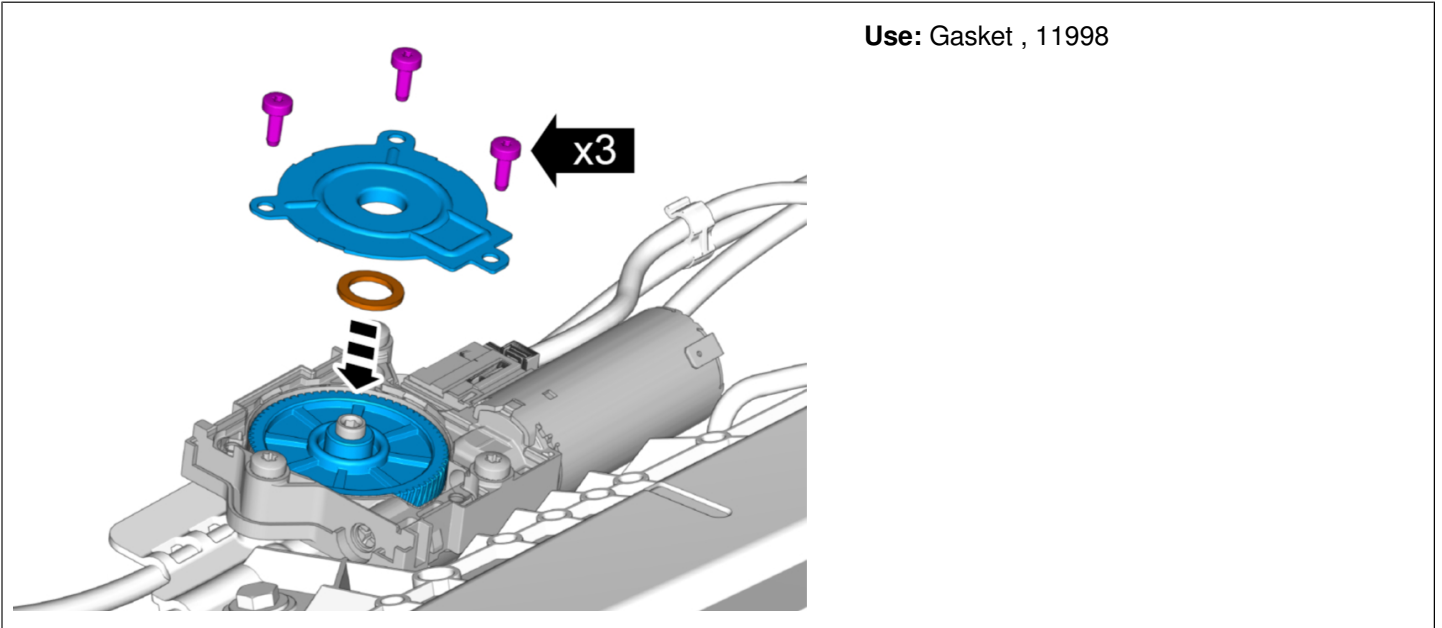

To install, reverse the removal procedure.