

GPOP - Issue Review System

Part Number: 68312084A\$

Part Description: Tailgate Cable

- Issue Description:**
1. If replacing this cable for slack or loose on one side; first swap the cables left to right; does the issue follow the cable?
 - a). If Yes, replace cable with slack.
 - b). If No, a new shorter service cable PN 68488335A\$ will resolve the issue if slack is greater than 18 mm of sag when compared to a straight edge from both ends of the cable.
 2. If the issue improves following the left to right swap no further repair needed.

~ ~ ~
Contact Us at CAGRIS@Chrysler.com for feedback related ONLY to this GPOP Tech Tip. DO NOT email regarding repair procedures unrelated to this Tech Tip or part order inquiries. Please include the Part Number (s) and Tech Tip Part Description of the Tech Tip you are referencing for our tracking system.
