

Special Service Message

NOTE: A Special Service Message is a formal communication issued by Land Rover and carries the same importance of a Technical Service Bulletin. An SSM is a quick method of communicating "Need To Know" information to the technical service community. SSM's may be issued in advance of a technical bulletin or may be the only communication on a given topic. All information contained in Land Rover technical communications are intended for use by trained, professional technicians with the knowledge, tools, and equipment required to complete the procedure correctly and safely. It informs the Technicians of conditions that may occur on some vehicles, or provides information that could assist in correct vehicle and diagnostic service.

SSM 74762 - L663 Defender: Clips break off during cladding removal and re-fitment

Models : Defender/L663

(SALEA7BUXL2000584)

Engineer :Pliešovský Rastislav

Date Last 25 MAY 2020 06:47:53

Updated :

Content :Issue:

Accessory kits do not contain lantern clips which may break off during removal and re-fitment of claddings.

Cause:

Clips are 'one-time' use and have been omitted from various accessories kits.

Action:

Please order the necessary quantities of clips LR112137 when placing an order for the following accessories to enable the re-fitting of the cladding/sill when the accessories are fitted.

VPLEP0387 - Mudflaps - Classic - Front - Requires maximum 4 clips

VPLEP0389 - Mudflaps - Std - Front - Requires maximum 4 clips

VPLEP0422 - Deployable Side Step Aero Shield/ Undertrays - Requires maximum 30 clips

VPLEP0391 - L663 90 Fixed Side Step - Requires maximum 30 clips

VPLEP0392- L663 110 Fixed Side Step - Requires maximum 30 clips

VPLEP0433 - L663 90 Cosmetic side tube - Requires maximum 30 clips

VPLEP0434 - L663 110 Cosmetic side tube - Requires maximum 30 clips

Accessory fitting instructions and parts catalogues have been updated to reflect this requirement.

Version : 2