

## STAR ONLINE PUBLICATION


**Case Number:** S2008000038

**Release Date:** 04/03/2020

**Symptom/Vehicle Issue:** Front Fogs Lamps Flicker Or Do Not Turn On Intermittently

**Customer complaint/ technician observation:** Owner Complains the front fog lamps occasionally flicker. Technician observed DTC's set in the BCM, BCM B16FB-15 Front Right Fog Lamp Control-Circuit Short to Battery or Open, B16F7-15 Front Left Fog Lamp Control-Circuit Short to Battery or Open.

**Repair Procedure:** Inspect the XY291, 34-way black connector, located behind the passenger front wheel liner for any spread, corroded or pushed out terminals. Replace and or secure circuits or connector as needed to complete.

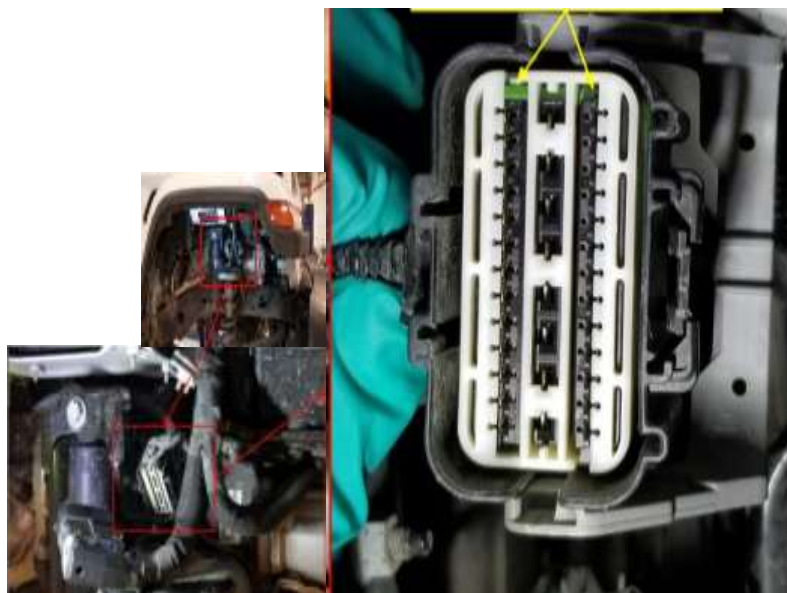

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

**Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found**