

Service Bulletin

Bulletin No.: 20-NA-048


Date: April, 2020

TECHNICAL

Subject: Rattle Noise from Driver or Passenger Seat Belt

Brand:	Model:	Model Year:		Date Breakpoint:		Engine:	Transmission:
branu:		from	to	from	to		
	Silverado 1500 (New Model)						
Chevrolet	Silverado 1500 (New Model - 12th VIN Digit = 7) - 4WD	2019	2019				
GMC	Sierra 1500 (New Model)					All	All
Chevrolet	Silverado 1500	2020	2020				
	Silverado 2500HD/ 3500HD						
GMC	Sierra 1500						
	Sierra 2500HD/ 3500HD						

Involved Region or Country	North America, Europe, Russia, Middle East, Israel, Palestine, South America, Philippines, Australia, New Zealand, Egypt, Africa, South Africa
Additional Options (RPOs)	
Condition	Some customers may comment on hearing a rattle noise coming from the driver or passenger seat belt.
Cause	The cause of the condition may be too much clearance between the bezel and trim panel, which may allow a rattle noise generation.

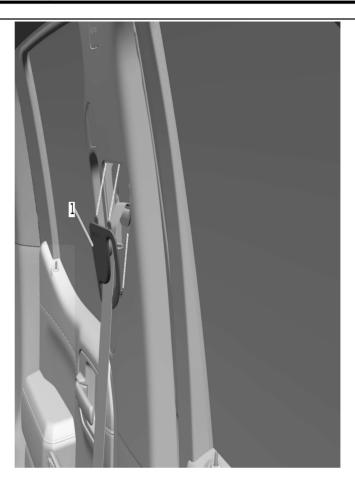

Correction

5424999

Note: DO NOT replace the seat belt retractor for this issue, as the seat belt opening bezel has now been released as a service part.

Upon verifying the condition, replace both front seat belt opening bezels (1), 2 per vehicle. Refer to *Front Seat Belt Opening Bezel Replacement (Front Belt)*, in SI.

Parts Information

Causal Part	Description	Part Number	Qty
	BEZEL-F/SEAT BELT OPG (DARK GREY / RT)	84241209	
	BEZEL-F/SEAT BELT OPG (DK ATMOSPHER / RT)	84241210	1
X	BEZEL-F/SEAT BELT OPG (BLACK / RT)	84100784	
	BEZEL-F/SEAT BELT OPG (DARK GREY / LT)	84241207	
	BEZEL-F/SEAT BELT OPG (DK ATMOSPHER / LT)	84241208	1
	BEZEL-F/SEAT BELT OPG (BLACK / LT)	84100782	

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
6440260	Front Seat Belt Opening Bezel Replacement	Use Published Labor Operation Time

Version	1
Modified	Released April 17, 2020