



Service Bulletin

Bulletin No.: 20-NA-094


Date: May, 2020

INFORMATION

Subject: Steering Assist Reduced, Service StabiliTrak and/or Park Brake Released Message Displayed On the Instrument Panel Cluster (IPC) Most Commonly After Auto Stop, DTCs C0800, U0121 Set

This Bulletin replaces PIT5739. Please discard PIT5739.

Brand:	Model:	Model Year:		Breakpoint:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Equinox	2018	2018	SOP	January 01, 2018	All	All
GMC	Terrain						

Involved Region or Country	United States, Canada, Mexico, Middle East, Israel, Palestine, Brazil (Mercosur), Chile (West), Colombia (West), Ecuador (West), Peru (West), Uruguay (West), GM Korea Company, Egypt, Other Africa
Condition	<div style="text-align: center;">  </div> <p style="text-align: right; font-size: small;">5587452</p> <p>Some customers may comment on a Steering Assist Reduced (1), Service StabiliTrak (2), as shown in the pictures above, and/or Park Brake Released message (Not shown) being displayed on the Instrument Panel Cluster (IPC) most commonly after auto stop.</p> <p>Note: There may be a steering assist reduction or, in extreme cases, loss of steering assist for a brief period (1-2 seconds). All of these symptoms appear most commonly after the engine restarts after an auto stop event.</p>