



Technical Service Bulletin

69 Pre sense malfunction message in the DIS, DTC B130494 and/or B130594 stored in the airbag control module

69 20 52 2059428/1 May 11, 2020.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A4, S4, A4 allroad, and Q7	2017 - 2019	All	Not Applicable
A5, A5 Cabriolet, A5 Sportback, S5, RS5, RS5 Cabriolet, S5 Sportback, Q5, and SQ5	2018 - 2019	All	Not Applicable

Condition

Customer states:

- The message "Pre Sense malfunction" is displayed in the driver information system (DIS).

Workshop findings:

- The function of the seat belts is not affected.

The following DTCs may be stored passive/sporadic in the airbag control module, J234 (address word 0015):

- DTC B130494** (Left front seat belt tensioner control module No unauthorized function).
- DTC B130594** (Right front seat belt tensioner control module No unauthorized function).

Technical Background

If the front seat belt is unbuckled while the seat belt is adjusting automatically to the occupant, the DTC and DIS message can occur when the seat belt is buckled again during the same ignition cycle.

Production Solution

Not applicable.



Technical Service Bulletin

Service

No repair is available at this time.

1. Do not perform any repairs. Any repairs for this concern may be denied.
2. The DTC(s) can be ignored and will be deleted automatically when exiting GFF in ODIS Service.



Tip: Parts replacement does not solve this issue. Claims for replaced parts will be subject to review.

Warranty

Claim Type:	<ul style="list-style-type: none">• 110 up to 48 Months/50,000 Miles.• G10 for CPO Covered Vehicles – Verify Owner.• If the vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
Service Number:	6911		
Damage Code:	0040		
Diagnostic Time:	GFF	0150 0000	Time stated on the diagnostic protocol (Max 30 TU)
	Road test prior to the service procedure	No allowance	0 TU
	Road test after the service procedure	No allowance	0 TU
Claim Comment:	As per TSB #2059428/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Additional Information

All part and service references provided in this TSB (2059428) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2020 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or



Technical Service Bulletin

transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.