# Technical Service Bulletin

Mazda North American Operations Irvine, CA 92618-2922



Subject: DTC U2050:55 STORED AFTER REPLACING OR REPROGRAMMING TCU	Bulletin No.: 09-013/20
	Last Issued: 05/08/2020

## **BULLETIN NOTES**

This bulletin supersedes the previously issued bulletin(s) listed below. The changes are noted in Red.

Previously issued TSBs:	Date issued:
09-013/20	04/10/20

## APPLICABLE MODEL(S)/VINS

2019 Mazda3 vehicles (Japan built) with VINS lower than JM1BP\*\*\*\*\*147656 (produced before June 29, 2019)

2019 Mazda3 vehicles (Mexico built) with VINS lower than 3MZBP\*\*\*\*\*115095 (produced before June 29, 2019)

# DESCRIPTION

When the Telematics Communication Unit (TCU) has been replaced or reprogrammed and the software is updated to ones shown below, DTC U2050:55-TCU (Activation of remote control not implemented) may be stored in memory with the message "In-Vehicle Network Malfunction" displayed in the multi-information display.

- Japan built vehicles: BDGF-67CK2-B or later suffix.
- Mexico built vehicles: BDTS-67CK2-A or later suffix.

**NOTE:** The Description for DTC U2050:55-TCU will be added to MGSS.

This is caused by a communication error between the TCU, the Connectivity Master Unit (CMU), and the Body Control Module (BCM) when the control software in them are not of the version being ready for activation of connected service. To correct this concern, the control software of the TCU, CMU and BCM have been modified.

When you encounter this concern, reprogram (update) the BCM and the CMU to the latest version.

Page 1 of 5

**CONSUMER NOTICE**: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

# **REPAIR PROCEDURE**

1. Update the software version of the CMU to Version 7000C0A-NA01\_10050 or later using the MAZDA CONNECT Update Instructions on MGSS.

2. Reprogram the BCM with the Mazda Modular Diagnostic System (M-MDS) using Mazda Diagnostic And Repair Software (MDARS) and claim the labor hours according to the warranty information shown below.


## NOTE:

- If current calibration file name in the ECU FILENAME screen is same as shown below or with later suffix, reprogramming is not necessary.
- **[5HB]** If the vehicle is applicable to the Mazda Service Program MSP56, performing the MSP56 repair procedure updates the BCM (and LFU) to the modified version.

ECU name	Body	File name
	Japan built 4SD	BCKA-66S02-R
BCM	Mexico built 4SD	BDTS-66S02-M
	Japan built 5HB	BEMD-66S02-M


3. Perform "Activation Remote Control by Smart Phone"

NOTE: If this is not performed, DTC U2050:55-TCU and/or U2050:55-BCM will be stored.

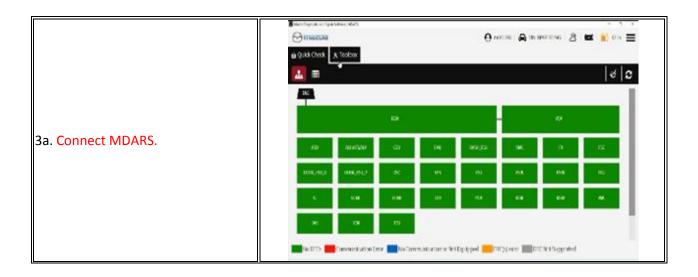

#### Page 2 of 5

**CONSUMER NOTICE:** The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

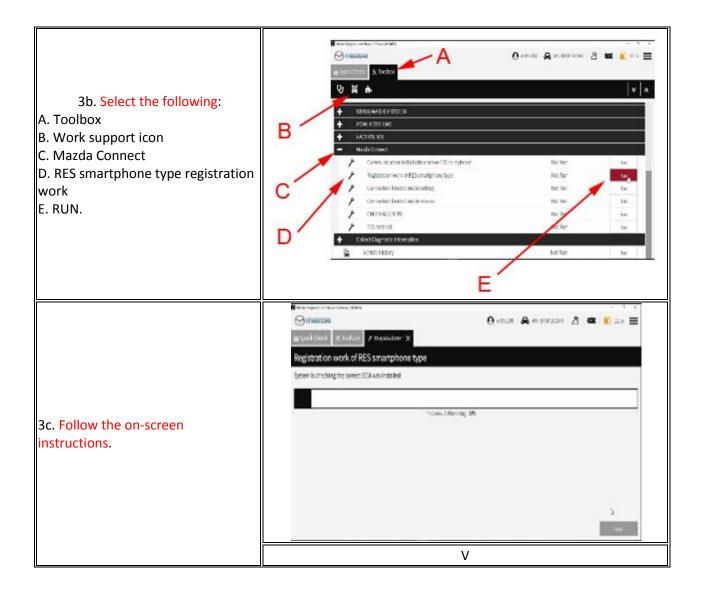

#### Page 3 of 5

**CONSUMER NOTICE**: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

Bulletin No.: 09-013/20	Last Issued: 05/08/2020

	The System State State State		
	🕞 mazza		
	With the Y-spin Applied A		
	Registration work of RES smartphone type		
	<ul> <li>Registration work of RES smartphone type</li> </ul>		
	Complexe		
	System the dead for constricting acts actualed.		
	Sentineer 10, information to a control op too.		
	Please door the CPL		
	Mice clear (MIC, quick decelved, ner automatically		
	Passe series Baselone DT.		
	a Not		
	declares an Aprilace M		
	égédétek kiteba		
3d. Select Quick Check (A),			
then start the engine and			
select the DTC Clear icon (B).	······································		
CAUTION: If the engine is not	- (40 4.045/3) 03 (44) 140.05 (44 (4 /20)		
started, DTC P2610 is stored and	102(13) 102(13) 10 10 10 10 10		
cannot be erased.			
	10 TO		
	💼 he DTCs 🗰 Convenienter Einer 💼 nie Germanisatien er Net Egylege ei 🚾 ETC (s odet 📖 DTC Net Eigenened		

4. Verify repair.

Page 4 of 5

**CONSUMER NOTICE**: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

## WARRANTY INFORMATION

NOTE:

- If the TCU has been replaced for warranty repair, claim additional hours using the labor operation number with "BRT" instead of the last three letters "BRX".
- If the TCU has been reprogrammed for warranty repair, claim additional hours using the labor operation number with "xFT" instead of the last three letters "xFX".

Additional reprogramming	Additional hours
CMU	0.1 Hrs.
BCM	0.1 Hrs.
CMU BCM	0.2 Hrs.

Example:

Replacing TCU	T0524BRX / 0.4 Hrs.
With reprogramming CMU	T0524BR <b>T</b> / 0.5 Hrs.
With reprogramming BCM	T0524BR <b>T</b> / 0.5 Hrs.
With reprogramming CMU_BCMT0524BR <b>T</b> / 0.6 Hrs	

Page 5 of 5

**CONSUMER NOTICE**: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.