



## Preliminary Information

### PIT5492C Diagnostic Tip - Battery Discharged Overnight

#### Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Colorado	2015 - 2020	All	All	All	All
GMC	Canyon	2015 - 2020	All	All	All	All

#### Supersession Statement

This PI was superseded to update Model Years. Please discard PIT5492B.


The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

#### Condition / Concern

**The customer may state that the battery is discharged overnight. The technician may duplicate a 150mA to 450mA draw.**

#### Recommendations / Instructions

**Inspect X301 (Headliner to Body Harness near the CHMSL) for bent pins as shown below. Repair or replace terminals as needed.**

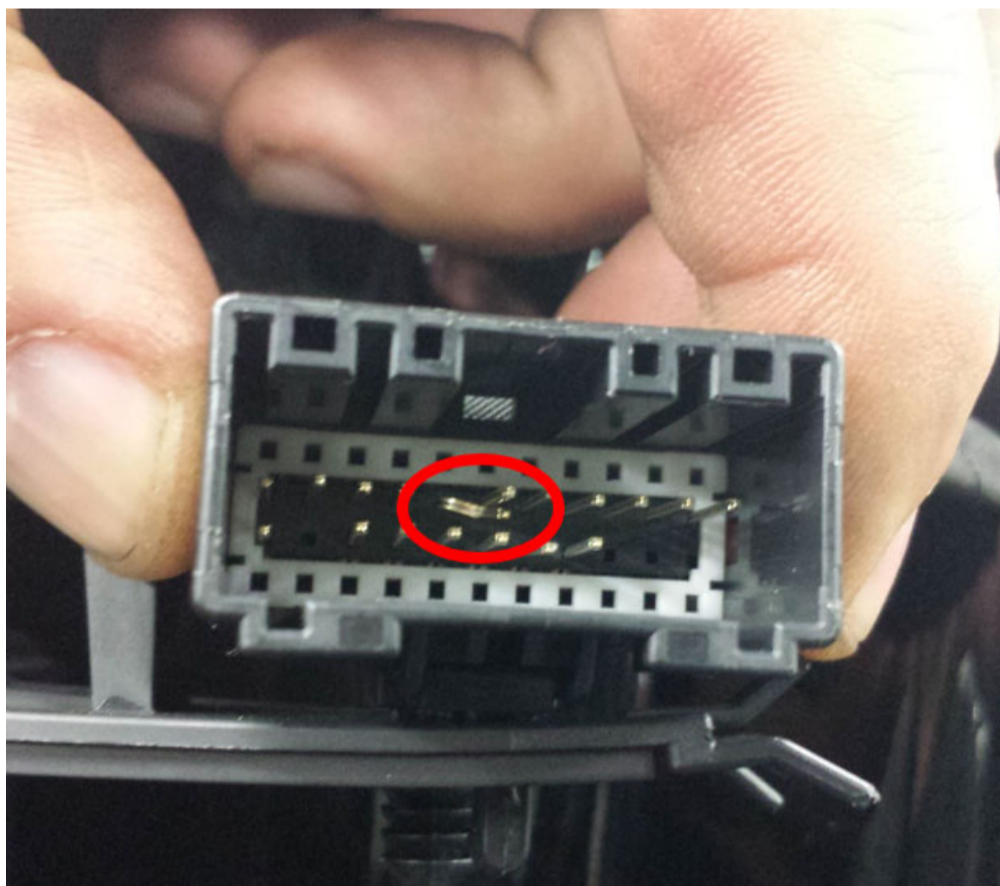

#### Warranty Information

**For wiring repairs covered under warranty, please refer to latest version of bulletin [10-00-89-005](#) for warranty information on wire/connector repairs.**

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.



GENERAL MOTORS

© 2020 General Motors. All Rights Reserved.