



**UPS Ford F59 Package Truck
Label and Decal Installation
ENP-737
May 27, 2020**

1. Introduction

The Agility service team has identified certain Package Trucks built on the Ford F59 chassis, powered by the Ford V10 with Agility CNG system, that did not have all the decals and stickers installed properly prior to delivery of the units. These units will need to have the labels installed as detailed in this publication.



Figure 1 Cylinder Sticker (1), Original Inspection Decal (2), VECI Label (3)

1.1 Warning Messages Used in this Bulletin

NOTICE

Best practices or hints to help an operation or procedure go smoothly.

2. Affected Units

57 Ford F59 Package trucks located in Southern California only

3. Tools and Materials

Description	
Flashlight	Update packet

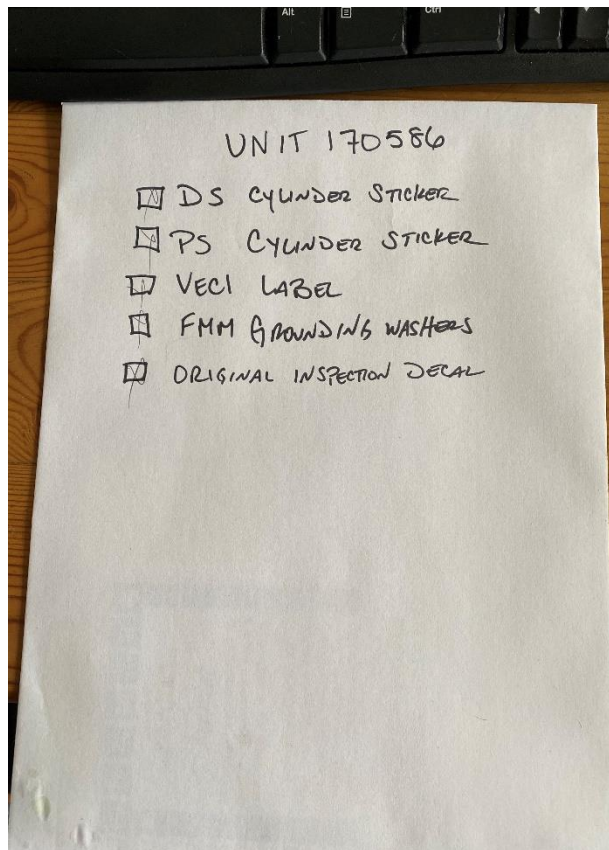


Figure 2 Update Packet

4. Corrective Action / Procedure

Cylinder Labels, Original Inspection Decals, and Vehicle Emission Control Information label (VECI label) need to be inspected and/or installed/replaced.

⚠ CAUTION

Observe all safety measures for CNG vehicle repair including all facility requirements.

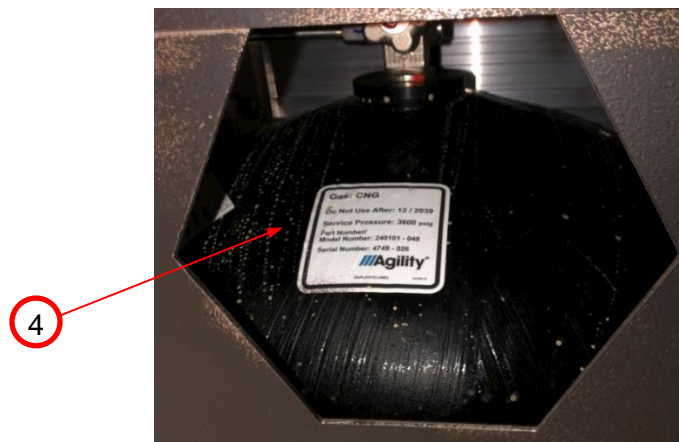


Figure 3: Cylinder sticker (4)

1. Using a flashlight, inspect under the unit for cylinder stickers (4) visible through the hexagonal opening in the cylinder shield.
2. If stickers are present, validate the serial number matches the stickers provided in the update kit. If stickers are not installed, wipe down cylinder with a clean rag and install sticker at the “6 o’clock” position on the tank, ensuring serial are visible through shield opening.



Figure 4: Original Inspection Decal (5), Morgan Olson build label (6).

3. Install original inspection decal (5) onto bulkhead behind the driver seat next to Morgan Olson build label (6).



Figure 5: Passenger Valve Cover (7), OEM VECI Label (8), Agility VECI Label (9)

4. Locate OEM VECI Label on the passenger valve cover. Remove original Agility VECI label and install new label provided in update packet. **Use caution when removing the new label from the backing. They are very brittle and can tear. If label tears, please request one from Agility support with unit information. Email support@agilityfs.com.**