

**Technical Tip** 2056397/2 **Transaction No:** 

27-19-03TT - No Crank - Sporadic - DTC P06E9

Release date:

06/12/2020

# Condition

#### **ATTENTION:**

THIS IS A TECH TIP, NOT A TECHNICAL BULLETIN.

TECH TIPS ARE NOT ASSOCIATED WITH WARRANTY CLAIMING.

# **Applicable Vehicles**

Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Atlas	2018-2019	All	All	All	All

Revision Table						
Instance Number	Published Date	Version Number	Reason For Update			
2056397/2	6/12/20	27-19-03TT	To remove adaptation of the Battery Monitoring Control Module - <i>J367</i>			
2056397/1	10/4/2019	27-19-03TT	Original publication.			

# **Technical Background**

Sporadic failure to crank. DTC P06E9 possible.

DTC	Description
P06E9	Engine Starter Performance

### **Service**

Verify Starter Motor -B- low current circuits are operating correctly by listening for the Starter Relays -J906-, -J907- to click or verify voltage at the Starter Relays when the Starter Motor doesn't engage. If the low voltage side of the circuit can be eliminated as a potential cause of the issue, or if the vehicle is currently starting, check the high current portion of the Starter Motor circuit proceeding as follows:



The following areas need to be checked while the engine is cranking.

- 1. Voltage drop test the Positive Battery Cable from the positive post of the Battery to the Starter.
- 2. Voltage drop test the Negative Battery Cable from the Negative Battery Post to the Jump Start/Charging Post in the engine compartment.
- 3. Voltage drop test the Negative Battery Cable from the Frame Rail to the Transmission Ground Post.

If any are over 0.3V, replace the suspect cable. If the voltage drop is not excessive, replace the Starter Motor.



Technical Tip

2056397/2

**Transaction No:** 

**27-19-03TT - No Crank – Sporadic - DTC P06E9**Release date: 06/12/2020

# **Additional Information**

© 2020 Volkswagen Group of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen Group of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.

2