



NUMBER: 21-035-20

GROUP: 21 - Transmission and Transfer Case

DATE: May 8, 2020

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.

SUBJECT:

Flash: Transmission Control Module (TCM) Update

OVERVIEW:

This bulletin involves reprogramming the TCM with the latest available software.

MODELS:

2018 (GU) Alfa Romeo Stelvio

NOTE: This bulletin applies to vehicles within the following markets/countries: North America.

NOTE: This bulletin applies to vehicles equipped with a 2.0L I4 DI Turbo Engine (Sales Code EC2).

SYMPTOM/CONDITION:

Some customers may experience a Malfunction Indicator Lamp (MIL) illumination. Upon further investigation, a technician may find the following Diagnostic Trouble Codes (DTCs) have been set:

- P0002-00 - Fuel Volume Regulator "A" Control Circuit Performance.
- P026E-00 - Charge Air Cooler Coolant Pump Performance.
- P1066-00 - Cylinder 1 Oil Supply Solenoid Valve Switch Off Time Out Of Range.
- P26E4-00 - Starter Relay "B" Circuit.
- P2B61-00 - Engine Coolant Flow Control Valve Stuck Closed.
- P2BC1-00 - Lt Water Pump Smart Driver Module.
- U1008-00 - LIN 1 Bus.

Enhancements to this software release:

- Transmission shift quality improvements.

In addition, the following improvement is also available:

- Turbo coolant pump after run duration and on-off strategy update, to improve turbo O-ring durability.

DIAGNOSIS:

Using a Scan Tool (wiTECH) with the appropriate Diagnostic Procedures available in DealerCONNECT/Service Library, verify all related systems are functioning as designed. If Diagnostic Trouble Codes (DTCs) or symptom conditions, other than the one listed above are present, record the issues on the repair order and repair as necessary before proceeding further with this bulletin.

If the customer describes the symptom/condition listed above or if the technician finds the DTC, perform the Repair Procedure.

REPAIR PROCEDURE:

NOTE: The Powertrain Control module (PCM) must be updated to the latest available software at the conclusion of this repair procedure. Refer to all applicable published service bulletins for detailed repair procedures and labor times regarding updating the PCM software.

NOTE: Install a battery charger to ensure battery voltage does not drop below 13.2 volts. Do not allow the charging voltage to climb above 13.5 volts during the flash process.

NOTE: If this flash process is interrupted/aborted, the flash should be restarted.

1. Reprogram the TCM with the latest available software. Detailed instructions for flashing control modules using the wiTECH Diagnostic Application are available by selecting the application's "HELP" tab.
2. Clear any DTCs that may have been set in any modules due to reprogramming. The wiTECH application will automatically present all DTCs after the flash and allow them to be cleared.
3. Verify the PCM is programmed with the latest available software. Refer to all applicable published service bulletins for detailed repair procedures and labor times regarding updating the PCM software.

POLICY:

Reimbursable within the provisions of the warranty.

TIME ALLOWANCE:

Labor Operation No:	Description	Skill Category	Amount
18-19-05-MX	Module, Transmission Control (TCM) - Reprogram (0 - Introduction)	2 - Automatic Transmission	0.3 Hrs.

NOTE: The expected completion time for the flash download portion of this procedure is approximately 4 minutes. Actual flash download times may be affected by vehicle connection and network capabilities.

FAILURE CODE:

The dealer must use failure code CC with this Service Bulletin.

- If the customer's concern matches the SYMPTOM/CONDITION identified in the Service Bulletin, failure code CC is to be used.
- When utilizing this failure code, the 3C's (customer's concern, cause and correction) must be provided for processing Service Bulletin flash/reprogramming conditions.

CC	Customer Concern
----	------------------