

Service Bulletin

Bulletin No.: 20-NA-010


Date: May, 2020

TECHNICAL

Subject: Ticking/Tapping Noise Coming From the Front of Vehicle Near the Engine Cooling Fan Area

Brand:	Model:	Model Year:		VIN:		Engino	Transmission:
		from	to	from	to	Engine:	Transinission.
Chevrolet	Silverado	2017	2018			L5P	
	Silverado 2500/3500	2019	2019				
GMC	Sierra	2017	2018		LSP		
	Sierra 2500/3500	2019	2019				

Involved Region or Country	North America, Middle East, Israel, Chile and Thailand	
	Some customers may comment that a tapping or ticking noise can be heard coming from the front of vehicle near the engine cooling fan area.	

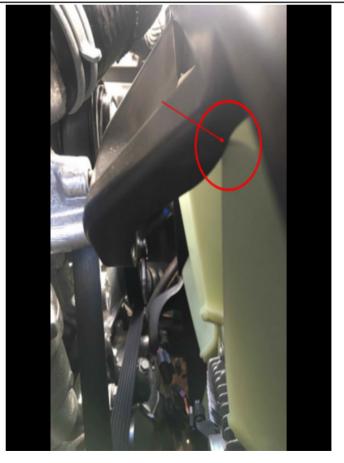

5485011

This condition may be caused by the engine fan blade contacting 1 or more of the 4 mounting tabs of the engine cooling fan shroud.

Cause

	If contact between the fan blade and shroud is observed, replace the Fan Blade.
	, ' '
Correction	 Do not modify the fan blade or shroud and do not replace the Engine Cooling Fan Shroud. A new Fan blade service part has been released to correct this contact condition.

Service Procedure

Refer to Fan Blade Replacement (L5P) in SI

Parts Information

No parts are required for this repair.

Causal Part	Description	Part Number	Qty
Х	BLADE, FAN	84890705	1

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
4032150	Fan Blade Replacement	Use the Published Labor Operations Time

Version	1
Modified	Released May 20, 2020