

## **Service Bulletin**

Bulletin No.: 20-NA-103

Date: May, 2020

## **TECHNICAL**

Subject: Malfunction Indicator Lamp Illuminated, DTC P0300 Set

Brand:	Model:	Model Year:		Breakpoint:		Engine	Transmission:
		from	to	from	to	Engine:	Transmission.
Chevrolet	Equinox	2018	2020	-	-	Equipped	-
GMC	Terrain					with 1.6L Engine (RPO LH7)	

Involved Region or Country	United States and Canada	
Condition	Some customers may comment on the Malfunction Indicator Lamp being illuminated.  Technicians may find the following DTC set/stored.  • P0300 – Engine Misfire Detected	
Cause	This condition may be caused by moisture build up inside the charge air cooler. Long drives through rainy conditions and/or high humidity conditions (heavy fog) can cause moisture to collect in the charge air cooler.  A heavy acceleration can draw moisture into the engine causing DTC P0300 to set.	
Correction	Install the lower portion of the grill cover, and advise the customer to use the cover when driving in the above conditions.  Note: The grille cover can be removed in non-raining, lower humidity or no fog type conditions.  Note: The grille cover should not be used in temperatures above 30C/85F, or when towing.	

## **Parts Information**

Causal Part	Description	Part Number	RPO
		84624274 (Equinox)	Without WBL or WFP
NA*	COVER PKG- FRT GRL OPG	84648360 (Terrain with front license plate bracket)	With VK3
		84630081 (Terrain without front license plate bracket)	Without VK3

\*For warranty transactions, DO NOT mark this/these parts as the Causal Part. Enter the word "Bulletin" in the Causal

Part Description free-flow text field.

## **Warranty Information**

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time	
1086018*	Perform Smoke Test and Install Charge Air Cooler Grille Cover	0.6 hrs. (Equinox)	
1000010	Perform Smoke rest and install Charge Air Cooler Grille Cover	0.5 hrs. (Terrain)	
*This is a unique Labor Operation for Bulletin use only.			

Version	1
Modified	Released May 19, 2020