

01-20-03TT - MIL ON, NOx Sensor Circuit Range/Performance Fault P2201

Release date:

6/19/2020

Condition

ATTENTION:

THIS IS A TECH TIP, NOT A TECHNICAL BULLETIN. TECH TIPS ARE NOT ASSOCIATED WITH WARRANTY CLAIMING.

| Applicable Vehicles | | | | | | |
|---------------------|-----------|--------------------|-------------|----------------|--------------|--|
| Model(s) | Year | Eng. Code | Trans. Code | VIN Range From | VIN Range To | |
| Passat | 2012-2014 | 2.0L TDI (CKRA) | All | All | All | |

Revision Table

| Instance Number | Published Date | Version Number | Reason For Update | | | |
|-----------------|----------------|----------------|-----------------------|--|--|--|
| 2059906/1 | 6/19/20 | 01-20-03TT | Original publication. | | | |

Technical Background

The newest variant of the -*J583*- NOx Sensor, part number 03L 907 807 **AF**, is known to be robust. If there is a fault with a vehicle equipped with the "AF" index NOx sensor variant, there may be other factors (such as exhaust leaks upstream of NOx Sensor) contributing to the DTC.

Service

- 1.) If DTC P2201 is stored, verify the part number of the NOx Sensor. If a sensor version prior to index "AF" is installed, proceed with GFF diagnosis. If sensor is faulty, verify there are no leaks in the exhaust (as outlined in step 2) and replace NOx Sensor with latest index per ETKA.
- 2.) If the "AF" index sensor is already installed on the vehicle, do not replace sensor on the first repair visit. Verify there are no leaks in the exhaust system upstream of the NOx Sensor, which may be contributing to erroneous sensor values. The VAS1687 tool is useful in pressurizing the exhaust, and a soapy water mixture works well to find leak areas. Pay close attention to the exhaust pipe connections on the exhaust flap for the low pressure EGR system. If leaks are identified, repair them as necessary. If the exhaust is verified to be leak free and an "AF" sensor variant is installed, replace the sensor if directed by GFF.



01-20-03TT - MIL ON, NOx Sensor Circuit Range/Performance Fault P2201

Release date:

6/19/2020



Figure 1. Example of exhaust leak at exhaust flap.

Additional Information

© 2020 Volkswagen Group of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen Group of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.