



HYUNDAI Technical Service Bulletin

GROUP

Body

NUMBER

20-BD-017H

DATE

June, 2020

MODEL(S)

Santa Fe (TMa)

SUBJECT:


FUEL FILLER DOOR HOUSING REPAIR

Description: This bulletin outlines the repair procedure to replace the fuel filler door housing on certain Santa Fe (TMa) vehicles if the fuel filler door is not flush to the body while closed, cannot fully close, or exhibits sagging/misalignment conditions while open. The existing fuel filler door panel will be reused.



Applicable Vehicles: Certain 2020MY Santa Fe vehicles

Parts Information:

Part Name	Part Number	Image
Fuel Filler Door Housing	81595-S1010	

NOTE: The existing fuel filler door panel will be reused with the replacement housing.

Warranty Information:

Model	Op. Code	Operation	Op. Time	Causal P/N	Nature Code	Cause Code
Santa Fe (TMa)	00DA20R0	Fuel Filler Door Housing Replacement	0.8 M/H	81595-S1010	B14	ZZ1

NOTE 1: Submit Claim on Campaign Claim Entry Screen

NOTE 2: If a part is found in need of replacement while performing this TSB and the affected part is still under warranty, submit a separate claim using the same Repair Order. If the affected part is out of warranty submit a Prior Approval Request for goodwill consideration prior to performing the work.

Circulate To: General Manager, Service Manager, Parts Manager, Warranty Manager, Service Advisors, Technicians, Body Shop Manager, Fleet Repair

Service Procedure:

1. Refer to the shop manual to remove the fuel filler door assembly (A).


**NOTICE**

Do not damage the body panel when removing the fuel filler door assembly.



2. Remove the existing fuel filler door panel (B) from the fuel filler door housing (C).

Reuse the existing fuel filler door panel (B), and install on the replacement housing.

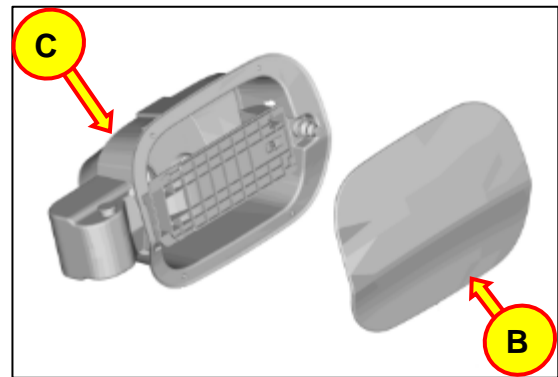

4. Reinstall all parts in reverse order of removal.
5. Verify that the fuel filler door operates properly and the concern is no longer present.
6. The service procedure is now complete.