

# Latest Vehicle Concern Fixes

## POWERTRAIN



### Multiple ABS & IPMA Messages Warnings on the Cluster

19 & 20MY Range Rover, RR Sport, All New Discovery with 3.0L TDV6 Engine & PHEV  
 19 & 20MY XE, XF AJ20P4  
 19MY RR Evoque, Discovery Sport  
 19 & 20MY E-PACE  
 19 & 20MY All 5.0L AJ133 & 3.0L AJ126 equipped vehicles

#### Customer Voice:

- Stability Control Not Available, Intelligent Emergency Braking System Not Available, ATPC Disabled, Forward Alert Not Available Messages are displayed on the Instrument Cluster.

#### Technical Description:

- P0120-81 – Throttle/ Pedal Position sensor 'A' circuit – invalid serial data received is stored in the PCM.
- All features associated with the aforementioned messages are disabled for the rest of the driving cycle.
- This issue may present itself more frequently with two-foot drivers as well as low traction launches (on ice, sand, etc.)

#### Status:

- Estimated Timing as follows:
  - AJ20D4 & TDV6 software is available on PATHFINDER
  - AJ20P4 is expected to be released 22-May
  - AJ126/ AJ133 software timing is still pending

