

## Latest Vehicle Concern Fixes

### POWERTRAIN



#### EGR Exhaust Flap Sticking- Check Engine Light

16-19MY Range Rover & RR Sport equipped with 3.0L TDV6 engine

##### Customer Voice:

- Check Engine Light illuminated on the cluster
- Customer may have a hesitation concern but this is not in every case

##### Technical Description:

- P0299 or P0234 maybe stored in the PCM in conjunction with exhaust/ EGR related codes

##### Status:

- This issue is caused by corrosion found on the exhaust flap which causes binding/ sticking
- This has been resolved in production.
- Report any cases after the assure VINs
  - SALGA2BK8KA532043 (Range Rover)
  - SALWA2BK0KA421224 (RR Sport)
- Please report any cases that do not have ANY EGR/ Exhaust related codes and only have Turbocharger Underboost/ Overboost codes and result in the replacement of the exhaust flap.

